

General Information

Date & Time: 20, Jul, 2026 15:51

Make	Toyota	Model	Ativ
YOM	2026	Odo Meter Reading	3,651
Registration No.	DCE9791	Chassis No.	MR2BE9B3XS0140347
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



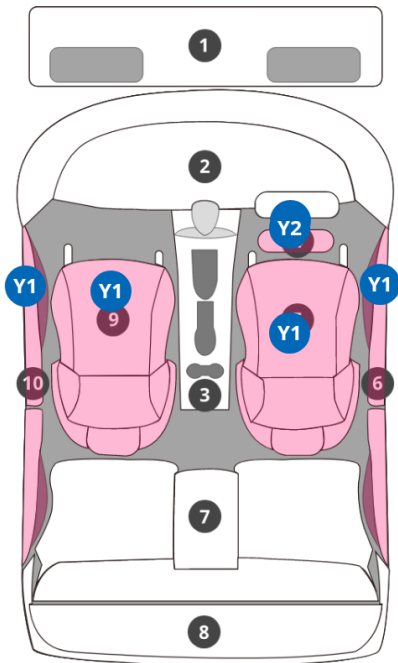
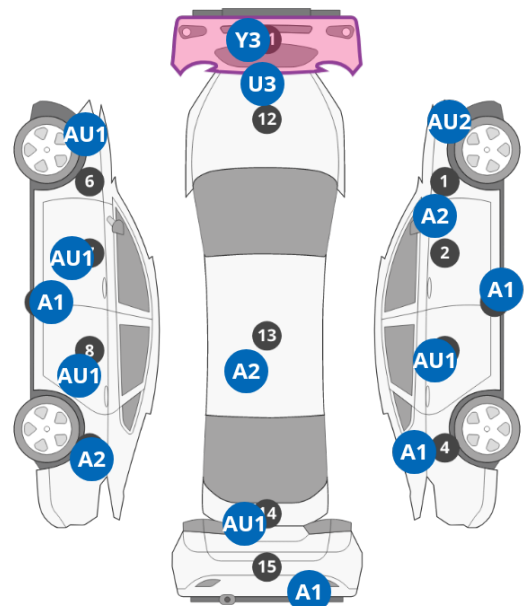
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	154.0	166	147	149
2	Boot Lid	160.6	162	152	168
3	Roof	179.5	185	178	172/183
4	Left Front Fender	151.0	147	158	148
5	Left Front Door	160.6	156	163	163
6	Center Panel Left				
7	Left Rear Door	159.0	170	159	148
8	Left Back Panel	166.3	187	159	153
9	Right Front Fender	166.3	174	168	157
10	Right Front Door	160.3	157	161	163
11	Center Panel Right				
12	Right Rear Door	160.0	157	153	170
13	Right Back Panel	169.3	176	166	166

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal	Remarks Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate at the trunk, with jack, with reverse camera, with warranty booklet, with spare tire, no tools, no spare key, minor scratches and dent on exterior, scratches in taillight and headlight.