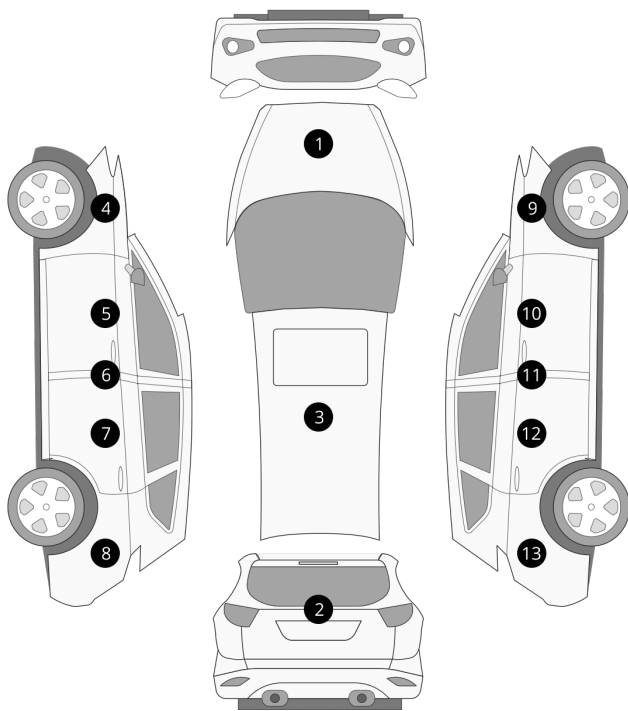


General Information

Date & Time: 21, Jul, 2026 10:22

Make	Mitsubishi	Model	Xpander Cross
YOM	2023	Odo Meter Reading	128,928
Registration No.	FAO2828	Chassis No.	MK2XRNC1WPN000954
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



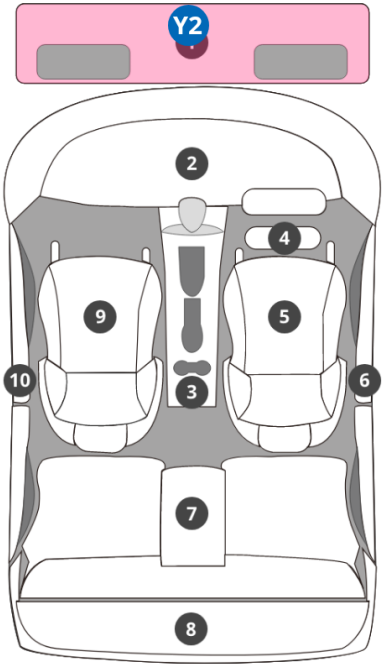
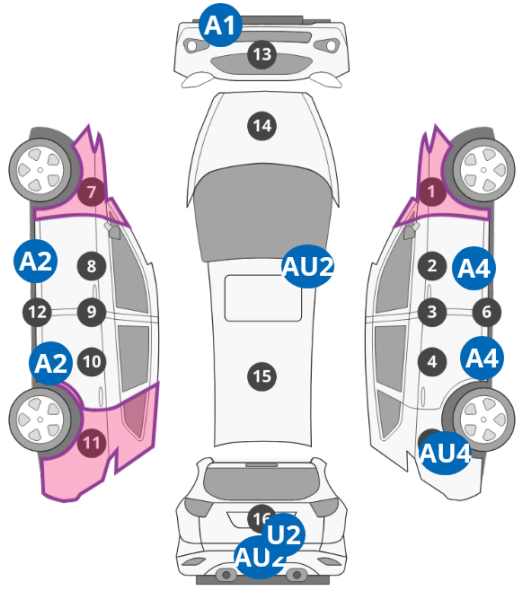
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	400.6	159	809	234
2	Boot Lid	109.6	111	108	110
3	Roof	181.5	183	202	180/161
4	Left Front Fender	390.6	764	203	205
5	Left Front Door	158.3	163	152	160
6	Center Panel Left				
7	Left Rear Door	122.6	123	122	123
8	Left Back Panel	129.6	133	137	119
9	Right Front Fender	194.6	201	179	204
10	Right Front Door	123.3	128	117	125
11	Center Panel Right				
12	Right Rear Door	91.3	89	93	92
13	Right Back Panel	114.6	109	116	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof Spoiler, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with Ito plates, no warranty booklet, no spare tire, no jack no tools, with hairline scratches itge body, with alarm in the panel, right front wheel missing hub cover