

General Information

Date & Time: 17, Jul, 2026 16:13

Make	Toyota	Model	Hilux
YOM	2022	Odo Meter Reading	166,257
Registration No.	CAW5528	Chassis No.	MR0CB8CB0M4272602
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



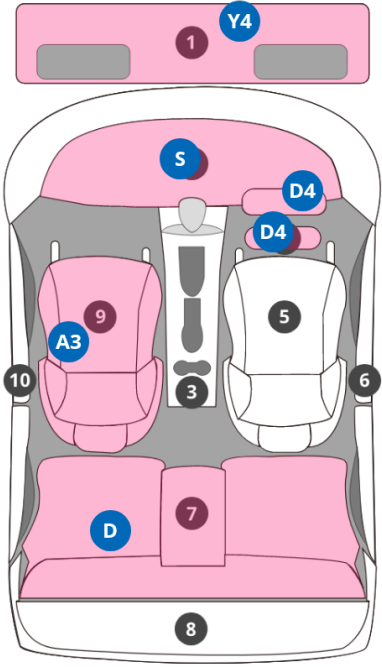
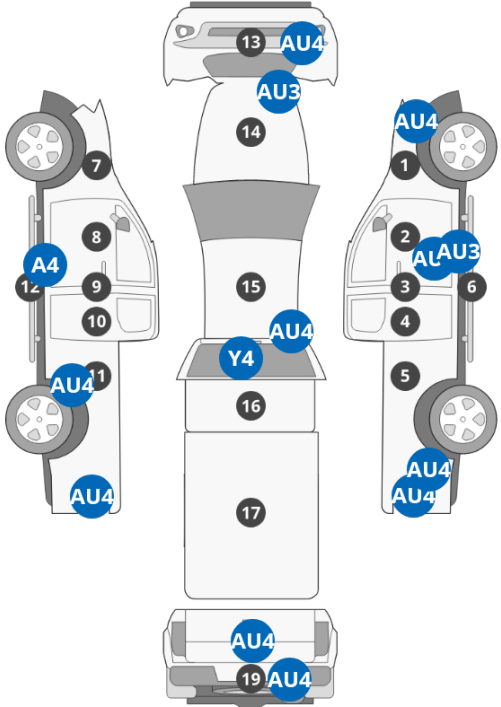
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	124	119	113
2	Boot Lid	191.3	186	182	206
3	Roof	110.5	109	96	107/130
4	Left Front Fender	114.6	114	113	117
5	Left Front Door	113.0	107	111	121
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	429.6	179	857	253
9	Right Front Fender	109.4	97	105	126
10	Right Front Door	142.6	106	107	215
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	218.0	193	213	248

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Worn - Yes / Instrument Panel - Loose, Deformed - Large / (L) Front Seat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Side Gate - Scratch & Dent - Large / (L) Guard Frame - Scratch & Dent - Large / Rear Windshield - Damaged - Large / Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Guard Frame - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Large / Roof - Scratch & Dent - Large
Frame Evaluation : C	Functional Evaluation : C
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Frame - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes

Inspector Notes

abnormal noise and engine vibration/ abnormal brake noise and feel/ / ABS warning light on/ airbag warning light on/ fuel filter warning light on/ possible flooding/ no jack and tools/ no spare tire/ light scratches around the exterior / with LTO plate