

General Information

Date & Time: 03, Mar, 2025 15:25

Make	Toyota	Model	Vios
YOM	2021	Mileage	79,640
Registration No.	NFI2176	Chassis No.	PA1B18F38M4148583
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



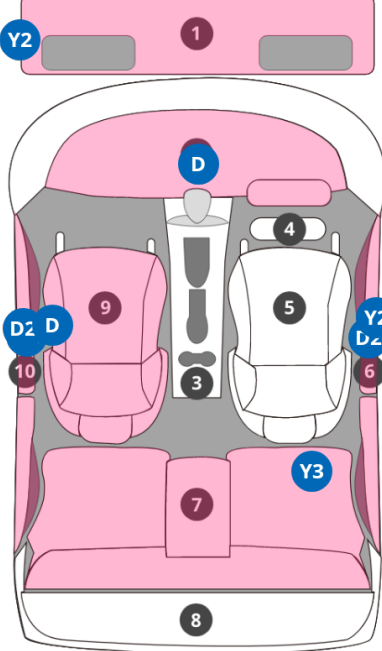
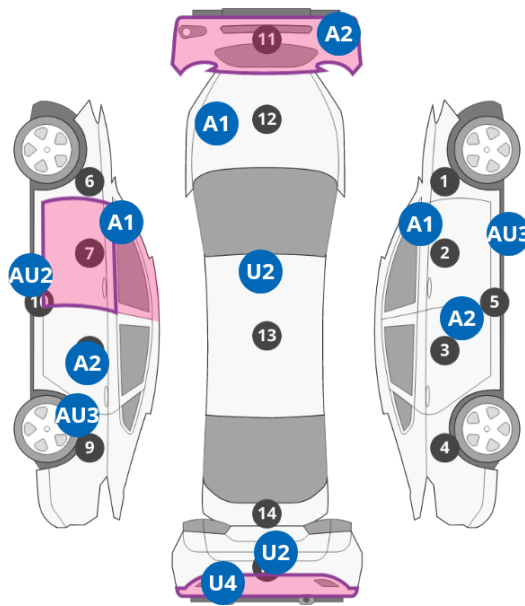
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	280.0	269	284	287
2	Boot Lid	106.6	103	116	101
3	Roof	98.6	117	86	101/91
4	Left Front Fender	209.0	199	207	221
5	Left Front Door	166.3	156	160	183
6	Center Panel Left				
7	Left Rear Door	102.1	105	103	98
8	Left Back Panel	106.0	118	99	101
9	Right Front Fender	175.0	210	168	147
10	Right Front Door	192.6	203	188	187
11	Center Panel Right				
12	Right Rear Door	94.0	92	91	99
13	Right Back Panel	104.0	99	110	103

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Worn - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Dent - Large / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : D	Functional Evaluation : C
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with jack, no tools, tire only, with LTO plate, air-conditioning issue, radio not working, reverse camera issue, bonnet stand issue, horn issue