


General Information

Date & Time: 03, Mar, 2025 16:44

Make	Toyota	Model	Vios
YOM	2024	Mileage	19,602
Registration No.	NHH6517	Chassis No.	PA1B18F36R4250133
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition

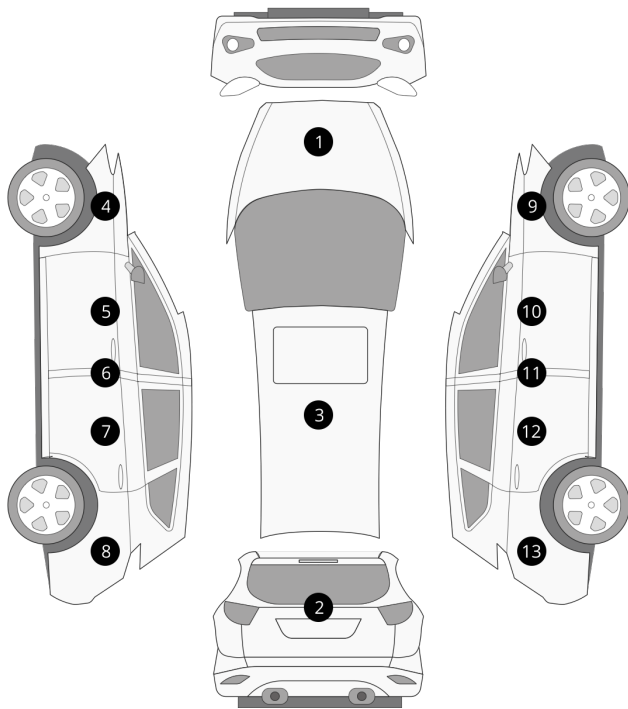


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	113	106	105
2	Boot Lid	83.1	83	78	89
3	Roof	99.8	104	106	100/89
4	Left Front Fender	94.8	98	92	95
5	Left Front Door	95.4	93	94	99
6	Center Panel Left				
7	Left Rear Door	105.5	100	118	99
8	Left Back Panel	98.0	108	95	91
9	Right Front Fender	107.3	113	106	103
10	Right Front Door	70.5	73	70	69
11	Center Panel Right				
12	Right Rear Door	79.8	75	75	90
13	Right Back Panel	88.0	90	87	88

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

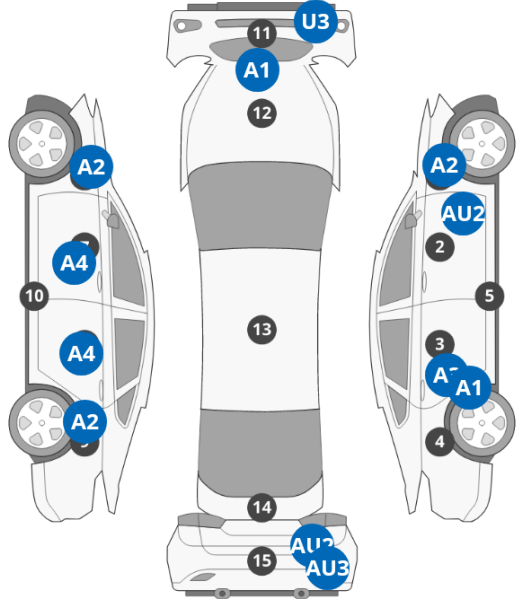Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Dent - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with jack and warranty booklets/trunk room can not open/spare tire and tools cannot be determined during to trunk issue