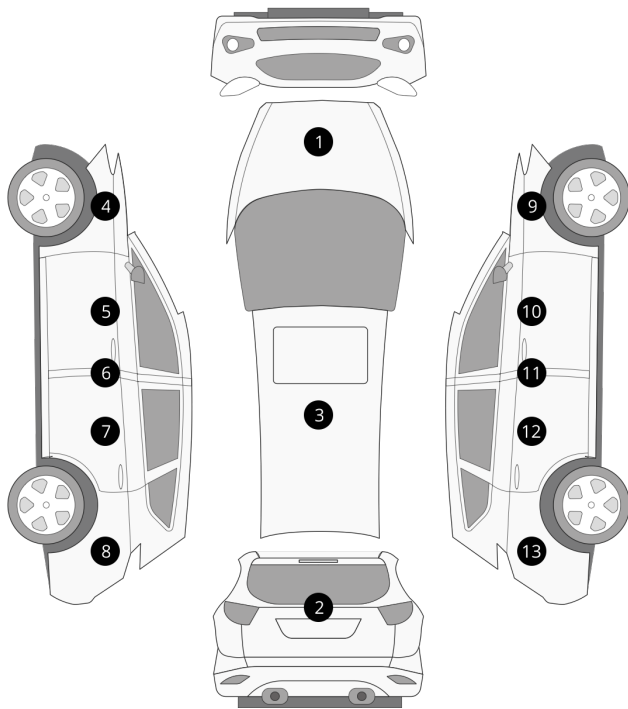


General Information

Date & Time: 04, Mar, 2025 10:58

Make	Toyota	Model	Vios
YOM	2024	Mileage	11,822
Registration No.	DBO6471	Chassis No.	PA1B18F35R4256165
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



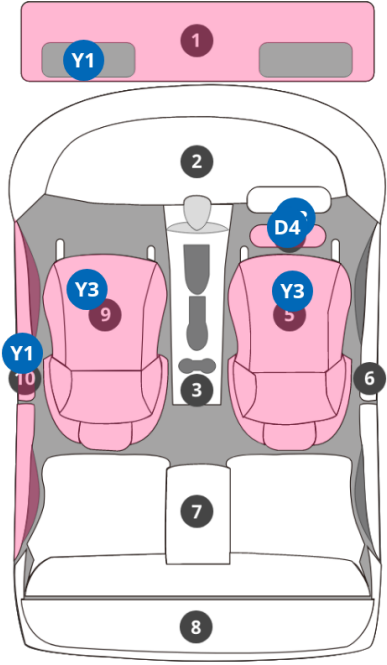
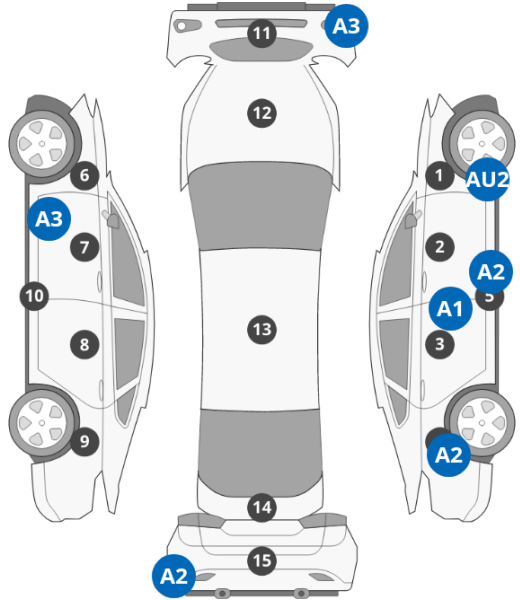
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	110	109	109
2	Boot Lid	99.5	101	102	96
3	Roof	101.8	105	107	93/102
4	Left Front Fender	97.0	94	106	92
5	Left Front Door	97.2	100	94	98
6	Center Panel Left				
7	Left Rear Door	103.8	109	111	92
8	Left Back Panel	105.3	121	97	98
9	Right Front Fender	96.0	97	90	101
10	Right Front Door	96.2	101	94	94
11	Center Panel Right				
12	Right Rear Door	106.3	97	106	116
13	Right Back Panel	98.1	97	102	96

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and incomplete tools, with spare tire, with LTO plate