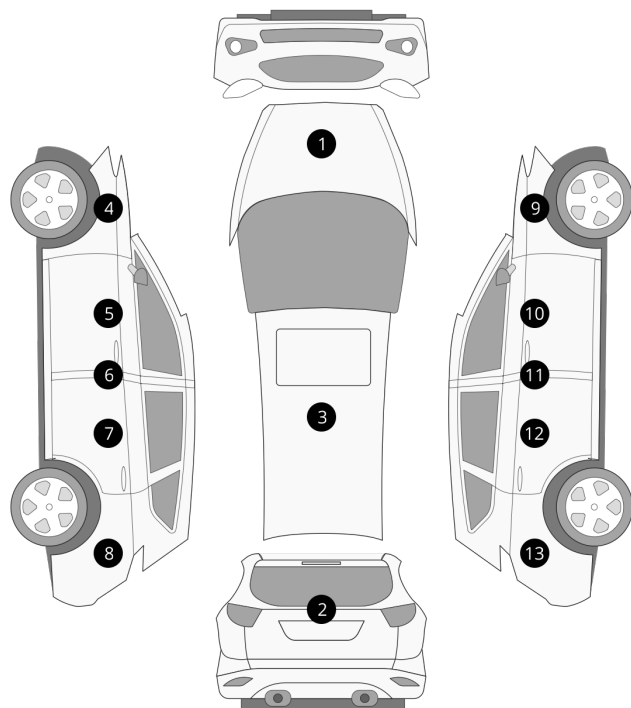


General Information

Date & Time: 22, Apr, 2025 15:33

Make	Toyota	Model	Vios
YOM	2022	Mileage	64,329
Registration No.	BAC3383	Chassis No.	PA1B18F31N4168921
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



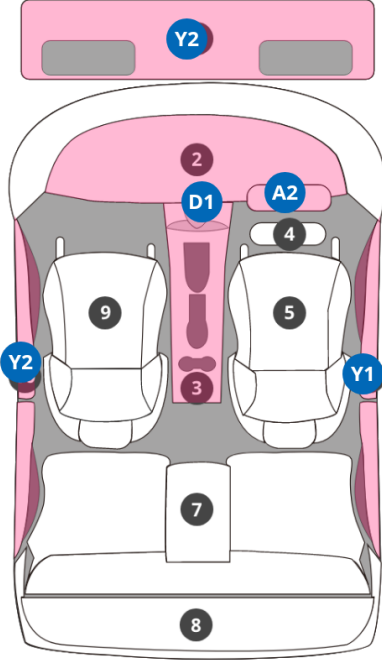
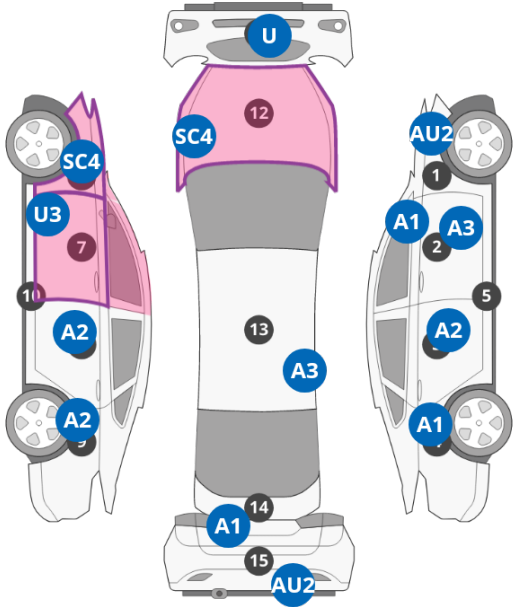
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	151.0	107	100	246
2	Boot Lid	99.9	97	103	100
3	Roof	90.8	102	84	88/90
4	Left Front Fender	200.3	195	201	205
5	Left Front Door	170.6	208	143	161
6	Center Panel Left				
7	Left Rear Door	98.1	100	100	95
8	Left Back Panel	99.3	106	96	96
9	Right Front Fender	82.6	86	80	82
10	Right Front Door	87.7	88	83	93
11	Center Panel Right				
12	Right Rear Door	88.1	84	87	93
13	Right Back Panel	92.4	94	88	96

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / Console, Switchs, Vents - Loose, Deformed - Minimal / (R) Front Trim - Grime - Minimal	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / Roof - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Rust, Corrosion - Large / (L) Front Fender, Molding - Rust, Corrosion - Large / (L) Front Door, Molding - Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack, incomplete tools, with spare tire,loosed left cheek light, paint splatter on right step in spoiler and right side rear bumper,cracked headlight,worn tires