

General Information

Date & Time: 22, Apr, 2025 17:06

Make	Toyota	Model	Vios
YOM	2024	Mileage	9,295
Registration No.	NHS6927	Chassis No.	PA1B18F32R4264594
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



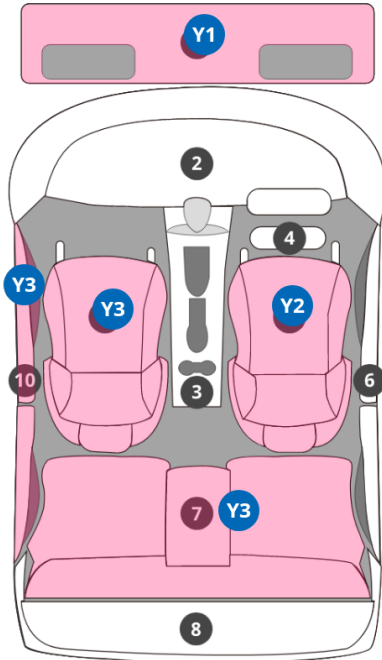
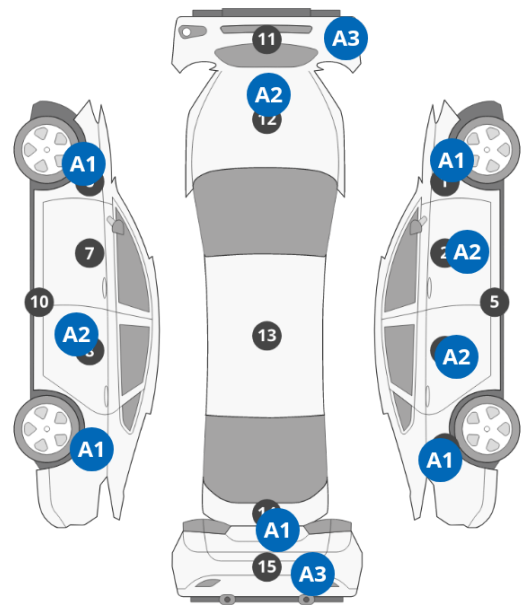
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.2	99	91	98
2	Boot Lid	89.0	85	90	92
3	Roof	91.0	93	94	81/96
4	Left Front Fender	81.5	86	77	82
5	Left Front Door	84.9	85	82	88
6	Center Panel Left				
7	Left Rear Door	92.3	94	92	91
8	Left Back Panel	93.0	95	94	90
9	Right Front Fender	91.3	93	88	93
10	Right Front Door	93.5	97	92	91
11	Center Panel Right				
12	Right Rear Door	88.9	86	86	94
13	Right Back Panel	92.7	91	87	100

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/with warranty booklets.