

General Information

Date & Time: 13, Nov, 2024 14:58

Make	Toyota	Model	Vios
YOM	2024	Mileage	8,262
Registration No.	DB09795	Chassis No.	PA1B18F31R4259838
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



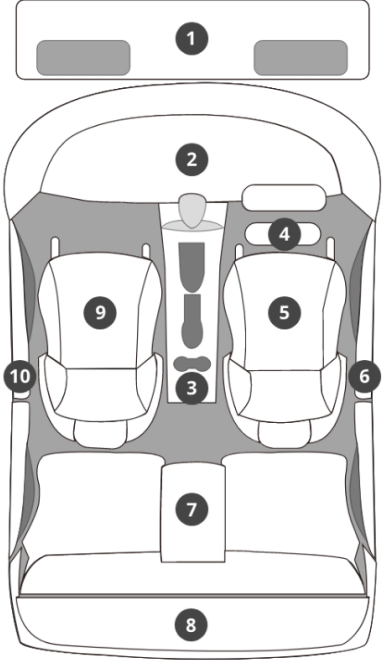
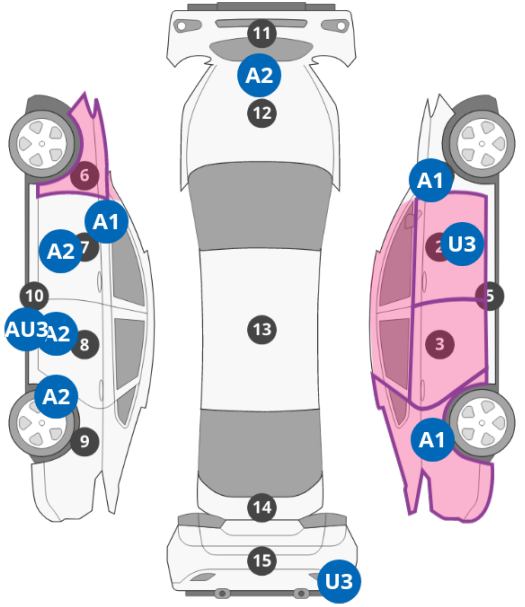
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	117	109	121
2	Boot Lid	116.0	111	114	123
3	Roof	110.2	119	111	100/111
4	Left Front Fender	193.3	214	207	159
5	Left Front Door	105.6	108	102	107
6	Center Panel Left				
7	Left Rear Door	112.3	119	114	104
8	Left Back Panel	121.3	154	104	106
9	Right Front Fender	107.3	105	110	107
10	Right Front Door	124.0	113	145	114
11	Center Panel Right				
12	Right Rear Door	142.3	144	154	129
13	Right Back Panel	146.3	120	153	166

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Defects not found	Remarks (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
swirlmarks and hairline scratches around the exterior. With warranty booklet and user manual.