

General Information

Date & Time: 03, Dec, 2024 11:02

Make	Toyota	Model	Wigo
YOM	2022	Mileage	44,383
Registration No.	NEX1699	Chassis No.	MHKA4DF5FMJ060706
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



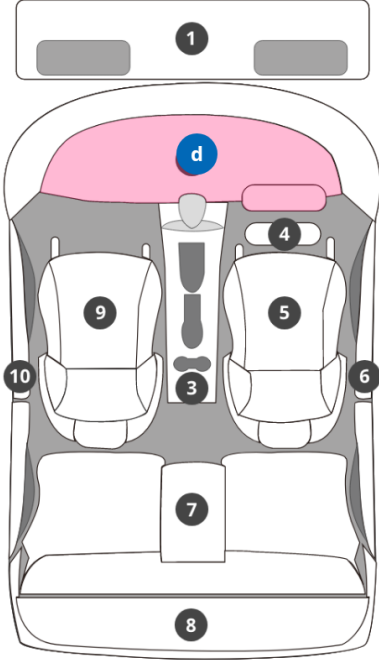
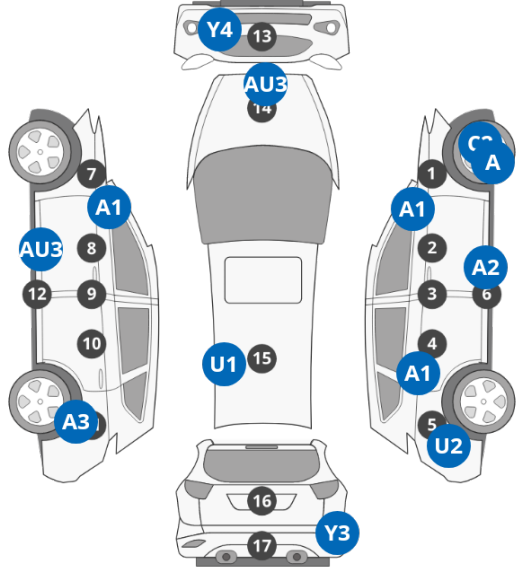
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.5	106	101	86
2	Boot Lid	98.6	96	104	96
3	Roof	85.8	71	92	92/88
4	Left Front Fender	94.1	83	101	99
5	Left Front Door	93.2	95	94	90
6	Center Panel Left				
7	Left Rear Door	93.9	104	92	86
8	Left Back Panel	98.1	92	109	93
9	Right Front Fender	96.6	96	100	94
10	Right Front Door	98.0	94	99	101
11	Center Panel Right				
12	Right Rear Door	97.0	94	99	99
13	Right Back Panel	90.6	94	91	88

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Wheel, Cover - Scratch, Corrosion - Small / (R) Front Tyre - Crack, Cut - Yes / (R) Rear Fender, Molding - Dent - Small / (L) Mirror - Scratch, Peeled - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Roof - Dent - Minimal / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Medium
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
cable of dashcam left inside the vehicle,battery leak,