

General Information

Date & Time: 17, Dec, 2024 07:00

Make	Toyota	Model	Vios
YOM	2023	Mileage	14,315
Registration No.	NIO2353	Chassis No.	PA1B18F37P4215615
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	BLACKISH RED MICA		

Body / Panel Condition



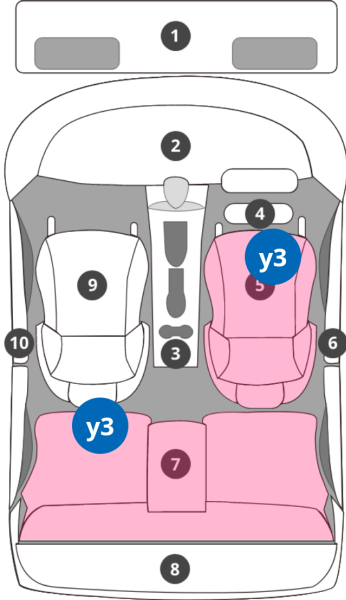
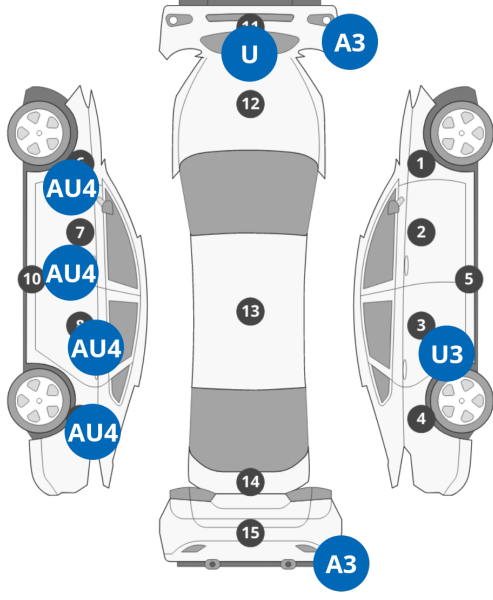
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.2	102	90	100
2	Boot Lid	95.2	89	99	98
3	Roof	90.9	94	92	84/94
4	Left Front Fender	90.8	93	87	92
5	Left Front Door	95.9	97	96	95
6	Center Panel Left				
7	Left Rear Door	99.5	106	97	96
8	Left Back Panel	97.2	110	93	89
9	Right Front Fender	90.6	90	86	96
10	Right Front Door	97.6	89	89	115
11	Center Panel Right				
12	Right Rear Door	93.9	93	91	98
13	Right Back Panel	95.8	94	92	101

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium	Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Dent - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
left rear door window cannot be opened fully due to the damage of the door/ left rear door cannot be opened/ no spare tire/ no tools/ with warranty booklet/ with jack