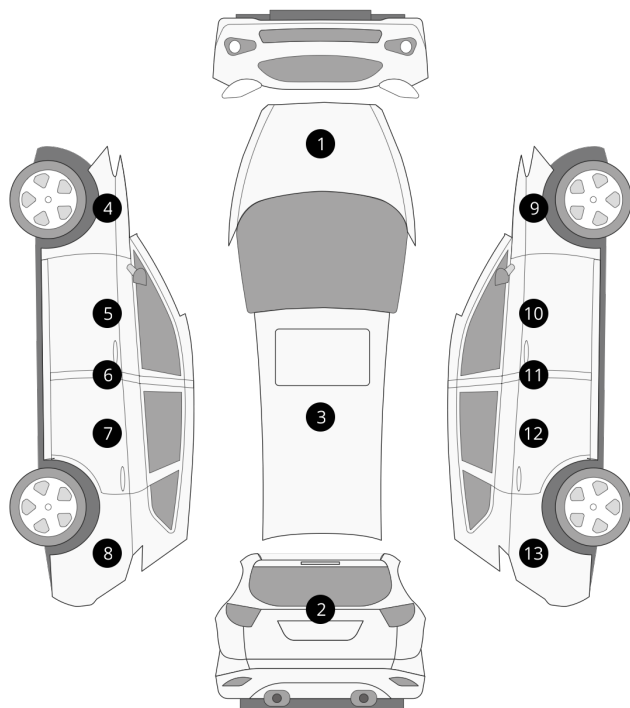


General Information

Date & Time: 13, Jan, 2025 15:38

Make	Toyota	Model	Innova
YOM	2022	Mileage	48,075
Registration No.	NFD1466	Chassis No.	PA2JA8EM1M0100190
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



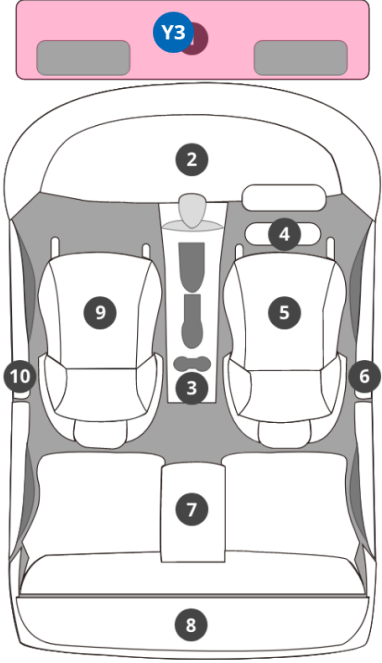
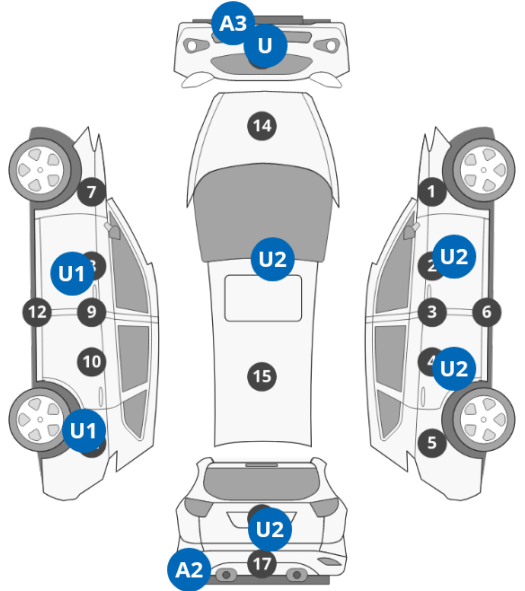
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	80.7	79	80	82
2	Boot Lid	180.6	171	188	183
3	Roof	94.9	100	88	91/101
4	Left Front Fender	96.3	102	102	85
5	Left Front Door	96.9	99	100	92
6	Center Panel Left				
7	Left Rear Door	147.0	152	144	145
8	Left Back Panel	102.3	97	113	98
9	Right Front Fender	241.3	140	434	150
10	Right Front Door	98.0	97	100	98
11	Center Panel Right				
12	Right Rear Door	91.0	88	90	95
13	Right Back Panel	103.4	98	108	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Dent - Minimal / (L) Front Door, Molding - Dent - Minimal / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with jack, spare tire and warranty booklet/ no tools/ with LTO PLATE