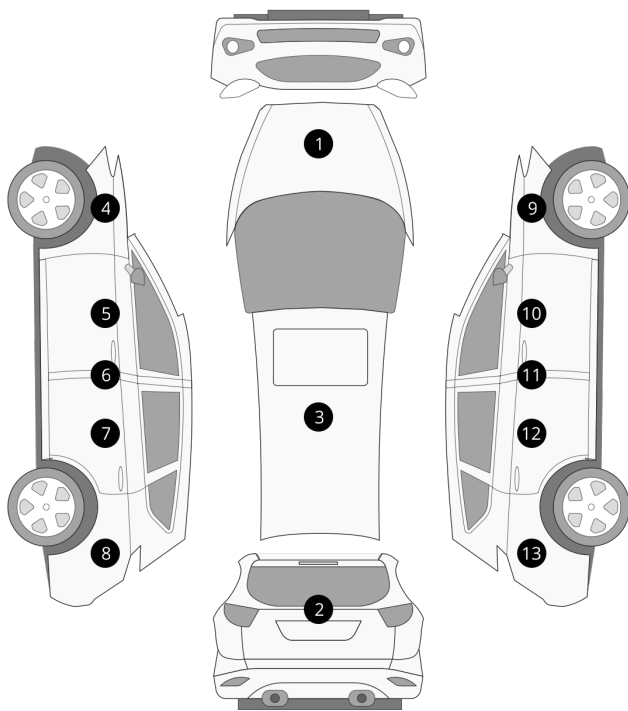


General Information

Date & Time: 13, Jan, 2025 15:53

Make	Toyota	Model	Vios
YOM	2023	Mileage	7,537
Registration No.	NHJ5694	Chassis No.	PA1B18F35P4216259
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



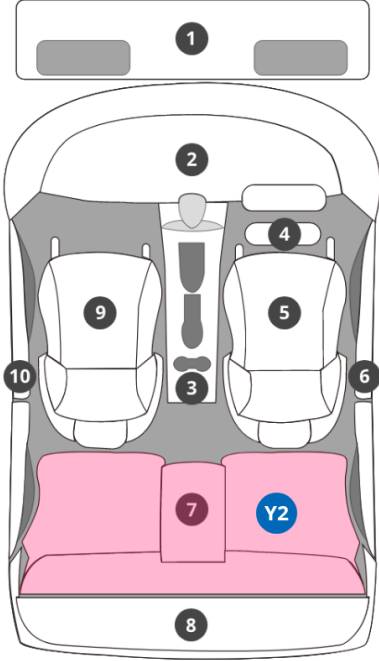
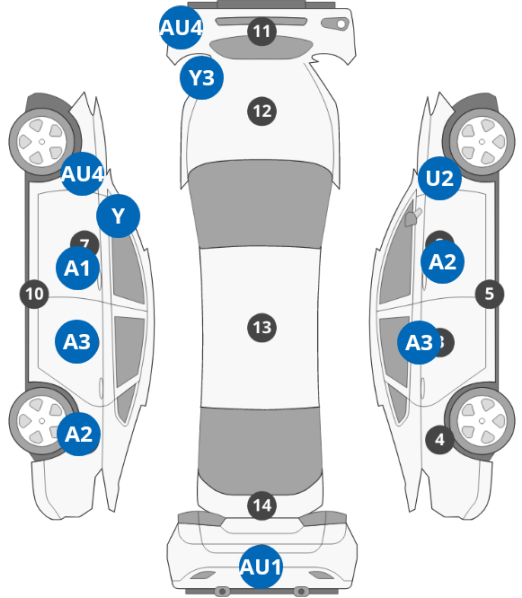
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	121	96	106
2	Boot Lid	100.9	97	101	105
3	Roof	91.9	98	92	81/96
4	Left Front Fender	95.6	94	93	100
5	Left Front Door	98.8	98	99	100
6	Center Panel Left				
7	Left Rear Door	98.0	109	95	90
8	Left Back Panel	99.7	100	101	98
9	Right Front Fender	105.3	107	112	97
10	Right Front Door	100.4	99	100	102
11	Center Panel Right				
12	Right Rear Door	101.8	100	101	105
13	Right Back Panel	94.9	92	95	97

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small	Remarks Bonnet, Headlight - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Mirror - Crack - Damaged / (R) Front Fender, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes

Inspector Notes

no warranty booklet and tools. no LTO plate number. traction control switch malfunction.