

General Information

Date & Time: 05, Feb, 2025 16:21

Make	Toyota	Model	Wigo
YOM	2021	Mileage	47,260
Registration No.	DAU7151	Chassis No.	MHKA4DF5FLJ049760
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



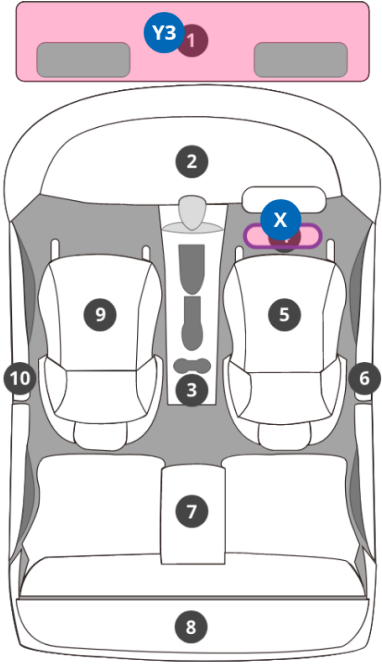
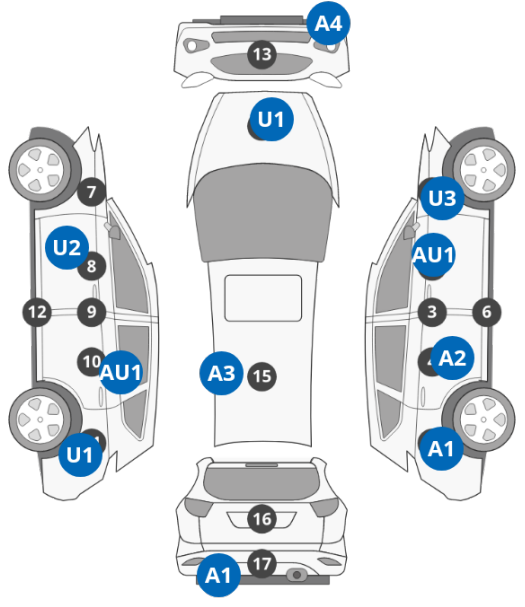
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	89.1	94	98	75
2	Boot Lid	105.7	122	101	94
3	Roof	86.5	81	87	89/90
4	Left Front Fender	92.0	84	95	97
5	Left Front Door	92.8	98	92	88
6	Center Panel Left				
7	Left Rear Door	99.9	94	108	98
8	Left Back Panel	90.5	94	91	86
9	Right Front Fender	94.6	99	97	88
10	Right Front Door	90.5	88	93	90
11	Center Panel Right				
12	Right Rear Door	91.4	91	94	90
13	Right Back Panel	96.9	101	97	93

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / Ceiling - Grime - Medium	Remarks (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Dent - Minimal / Roof Spoiler, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, with sparetire, no jack, no tools, with LTO plate, driver seat left side cover loose, front and rear left tire worn