

General Information

Date & Time: 02, Feb, 2025 15:24

Make	Toyota	Model	Vios
YOM	2021	Mileage	50,520
Registration No.	EAE7364	Chassis No.	PA1B18F30M4148013
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



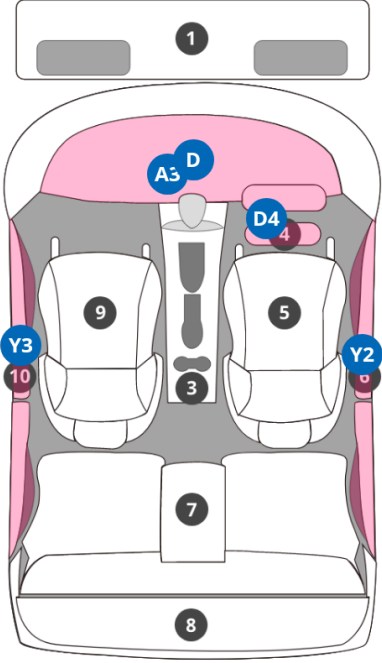
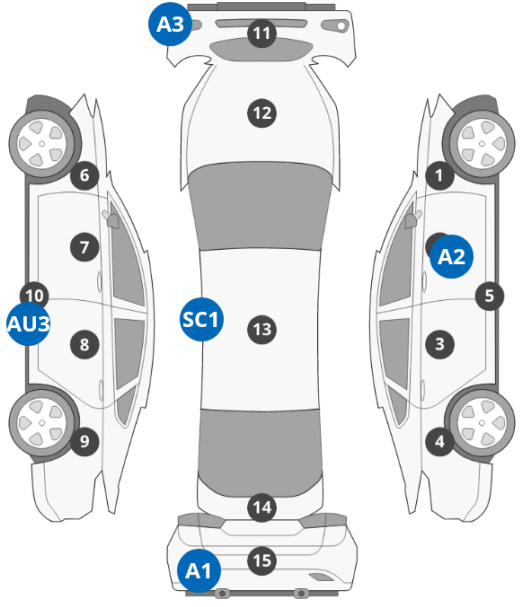
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	120	116	122
2	Boot Lid	127.6	126	127	130
3	Roof	107.7	108	99	113/111
4	Left Front Fender	108.0	105	115	104
5	Left Front Door	102.6	100	102	106
6	Center Panel Left				
7	Left Rear Door	113.6	129	105	107
8	Left Back Panel	124.0	137	122	113
9	Right Front Fender	158.6	136	186	154
10	Right Front Door	108.6	107	109	110
11	Center Panel Right				
12	Right Rear Door	113.3	110	113	117
13	Right Back Panel	120.3	109	117	135

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Medium / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Roof Spoiler, Molding - Rust, Corrosion - Minimal
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with spare tire, with jack and incomplete tools, no LTO plate, aircon air control issue, bonnet insulator missing/ power steering issue due to weak battery/