

General Information

Date & Time: 02, Feb, 2025 15:37

Make	Toyota	Model	Vios
YOM	2022	Mileage	66,248
Registration No.	BAE9665	Chassis No.	PA1B18F30M4163692
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



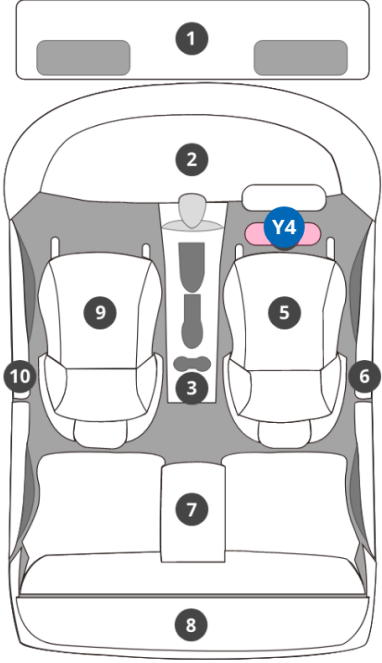
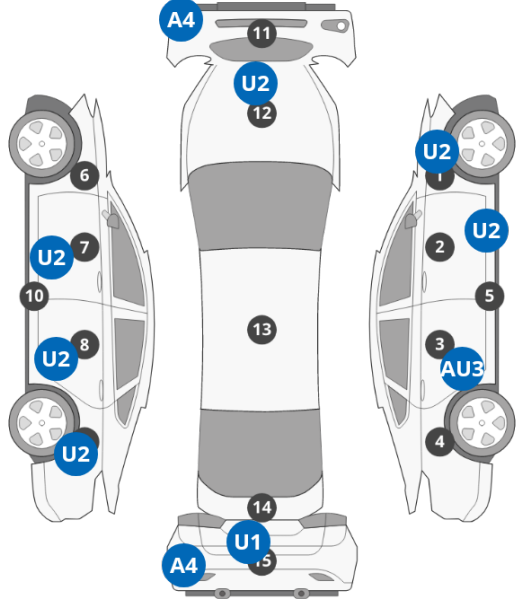
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	110	159	115
2	Boot Lid	108.3	104	107	114
3	Roof	102.8	112	90	100/109
4	Left Front Fender	105.0	103	100	112
5	Left Front Door	107.3	109	110	103
6	Center Panel Left				
7	Left Rear Door	109.3	108	115	105
8	Left Back Panel	120.0	121	122	117
9	Right Front Fender	106.6	113	103	104
10	Right Front Door	141.3	132	147	145
11	Center Panel Right				
12	Right Rear Door	100.3	99	98	105
13	Right Back Panel	104.9	99	107	109

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Large	Remarks Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Dent - Small / Bonnet, Headlight - Dent - Small / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate number /spare tire/jack/ incomplete tools/No warranty booklet/reverse camera no function