

General Information

Date & Time: 03, Feb, 2025 18:38

Make	Toyota	Model	Vios
YOM	2023	Mileage	39,050
Registration No.	NIR5447	Chassis No.	PA1B18F31P4217344
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



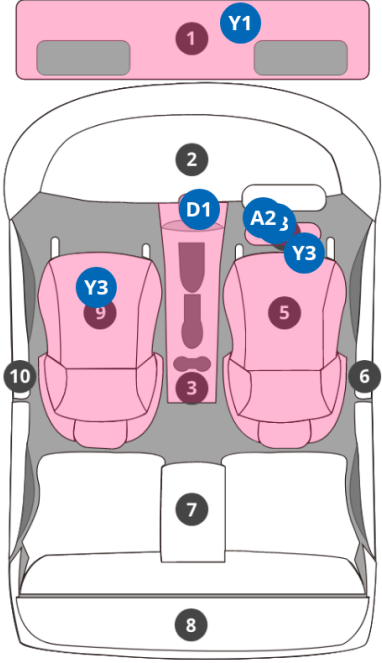
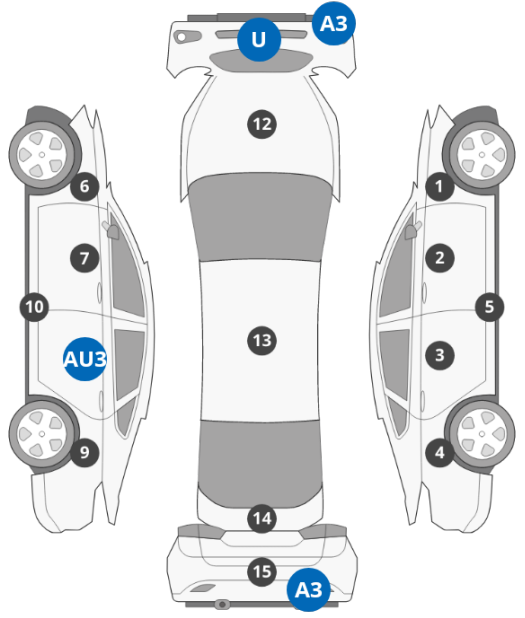
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	108	100	113
2	Boot Lid	104.6	100	105	109
3	Roof	96.4	102	94	89/101
4	Left Front Fender	105.9	114	97	107
5	Left Front Door	107.6	102	108	113
6	Center Panel Left				
7	Left Rear Door	104.6	107	104	103
8	Left Back Panel	124.3	132	118	123
9	Right Front Fender	224.0	127	166	379
10	Right Front Door	92.5	95	91	92
11	Center Panel Right				
12	Right Rear Door	103.3	100	104	106
13	Right Back Panel	149.6	121	138	190

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Console, Switches, Vents - Worked - Minimal / (L) Front Floor Mat - Cut, Crack - Medium / Carpet - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and incomplete tools, with spare tire, front right tire worn, no LTO plate