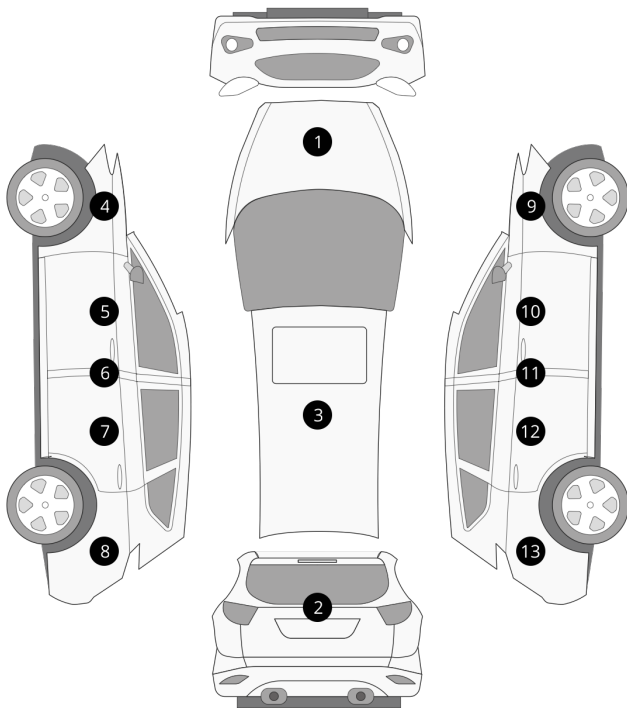


General Information

Date & Time: 05, Feb, 2025 16:05

Make	Toyota	Model	Wigo
YOM	2024	Mileage	13,367
Registration No.	DBO9298	Chassis No.	MHKAA1BC9RJ019268
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



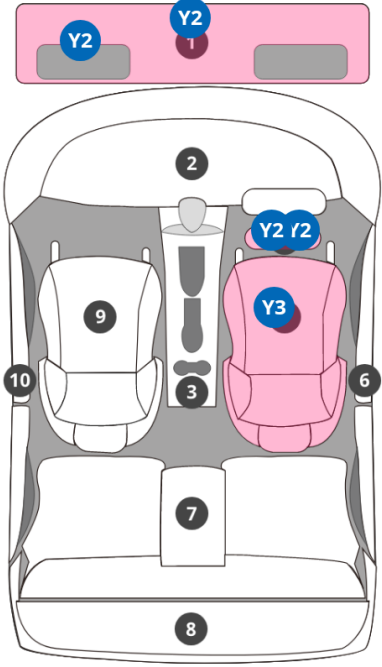
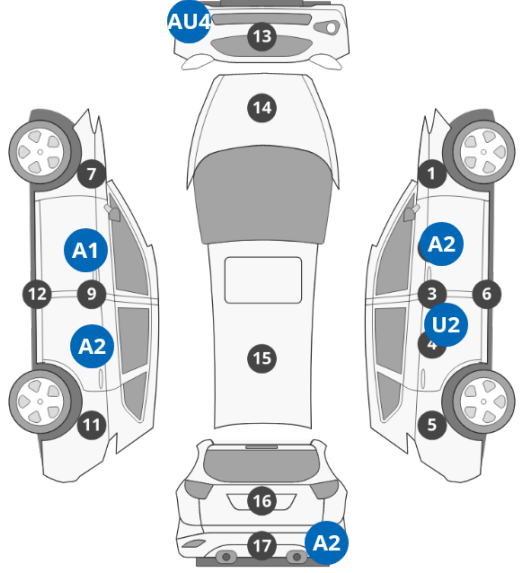
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	110	109	112
2	Boot Lid	81.6	82	86	77
3	Roof	73.6	77	73	76/67
4	Left Front Fender	93.6	96	98	87
5	Left Front Door	102.4	96	102	109
6	Center Panel Left				
7	Left Rear Door	97.3	97	100	95
8	Left Back Panel	85.2	93	80	83
9	Right Front Fender	81.3	83	82	79
10	Right Front Door	98.3	106	96	94
11	Center Panel Right				
12	Right Rear Door	95.8	93	92	103
13	Right Back Panel	83.0	87	83	80

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small / Mat Other - Grime - Small / Sunvisor, Sunglass Holder - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Rear Door, Molding - Dent - Small / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes

Inspector Notes
with spare tire, jack and tools. without warranty booklet. without LTO plate. adhesive marks at both side mirrors. Gap at both left and right side front bumper.