

General Information

Date & Time: 25, Feb, 2025 18:56

Make	Toyota	Model	Fortuner
YOM	2023	Mileage	21,000
Registration No.	NFP9061	Chassis No.	MHFAA8GS8N0786763
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



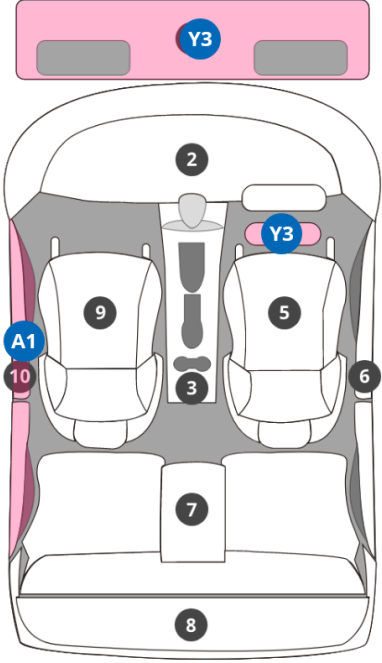
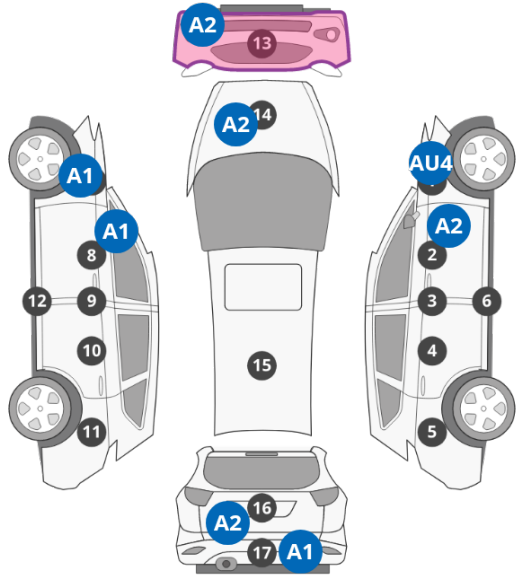
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.3	113	120	110
2	Boot Lid	88.3	82	94	89
3	Roof	119.3	129	136	115/97
4	Left Front Fender	109.3	122	101	105
5	Left Front Door	100.8	102	98	103
6	Center Panel Left				
7	Left Rear Door	95.2	111	89	86
8	Left Back Panel	110.9	112	122	99
9	Right Front Fender	114.3	124	105	114
10	Right Front Door	99.6	102	97	100
11	Center Panel Right				
12	Right Rear Door	92.3	84	90	103
13	Right Back Panel	118.0	132	105	117

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Cut, Crack - Minimal / Ceiling - Grime - Medium	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, no jack, no tools, with spare tire, with LTO plate, adhesive mark overall exterior, all wheel cap cover missing