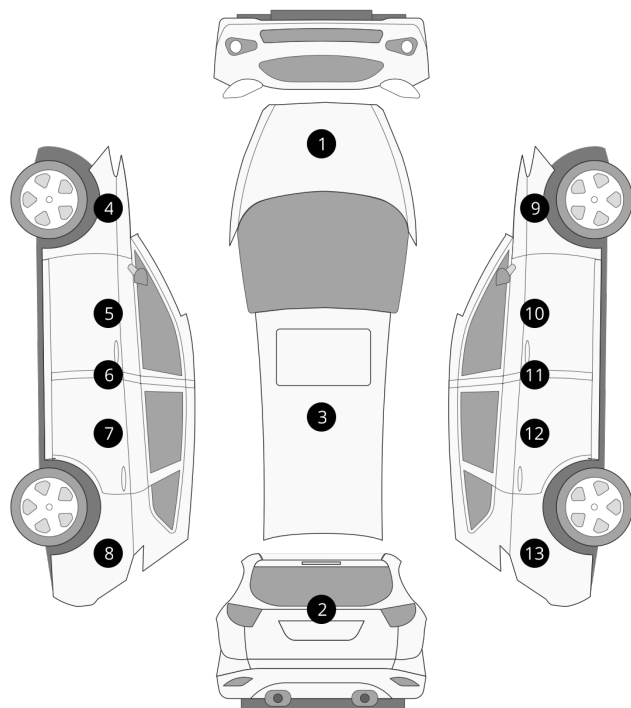


General Information

Date & Time: 22, Feb, 2025 09:37

Make	Toyota	Model	Vios
YOM	2021	Mileage	50,579
Registration No.	EAE5510	Chassis No.	PA1B18F35M4148542
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



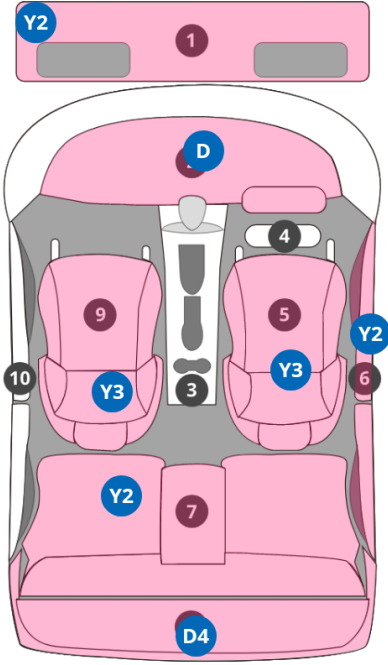
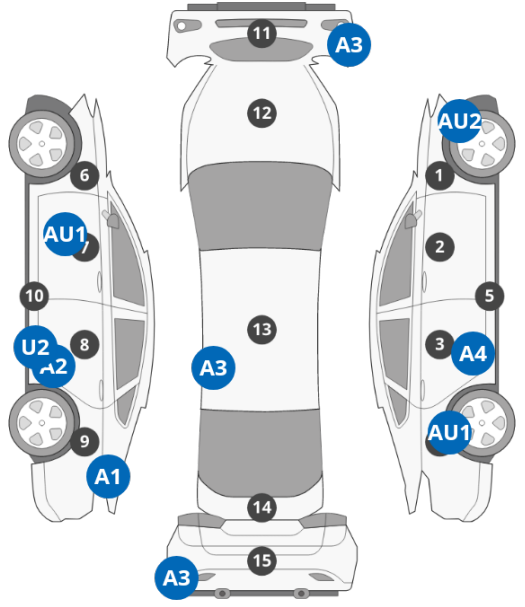
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.6	109	120	115
2	Boot Lid	106.3	100	107	112
3	Roof	98.4	109	90	101/93
4	Left Front Fender	98.0	112	95	88
5	Left Front Door	101.1	100	93	111
6	Center Panel Left				
7	Left Rear Door	98.6	102	103	91
8	Left Back Panel	99.7	101	97	101
9	Right Front Fender	87.5	79	93	91
10	Right Front Door	90.9	85	101	87
11	Center Panel Right				
12	Right Rear Door	92.0	89	96	91
13	Right Back Panel	102.1	92	111	103

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Trunk Room - Worked - Large	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Minimal / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, no tools, with spare tire, with LTO plate, grime on trunk floor cover