

General Information

Date & Time: 31, Jul, 2026 15:07

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	10,103
Registration No.	GBK2397	Chassis No.	PAHACACA1S6423830
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	White		

Body / Panel Condition



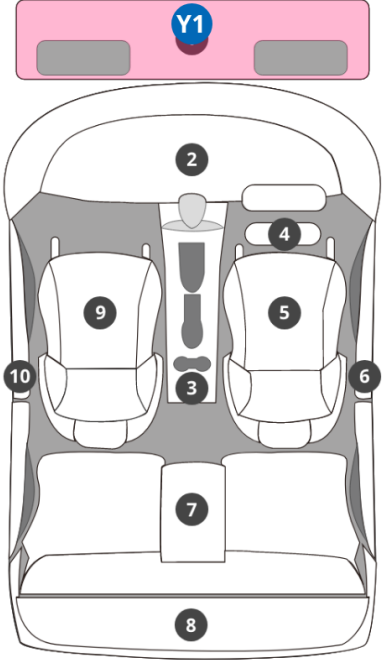
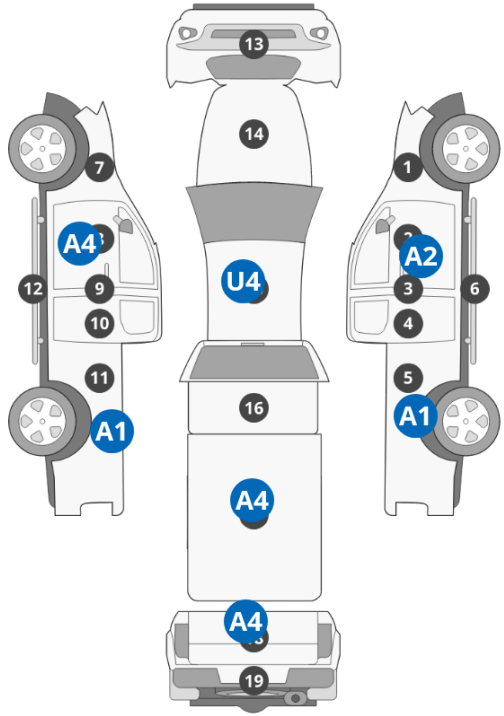
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	86.0	85	90	83
2	Boot Lid	46.1	45	41	53
3	Roof	110.9	122	115	100/107
4	Left Front Fender	88.7	88	92	87
5	Left Front Door	85.4	87	86	83
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	54.4	56	59	48
9	Right Front Fender	87.4	91	89	82
10	Right Front Door	84.5	80	86	88
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	57.8	59	58	57

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal	Remarks Roof - Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Minimal / Rear Gate - Scratch - Large / Cargo Bed Floor - Scratch - Large / (L) Side Gate - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
no lto plates, with warranty booklet, with soare tire, no jack, inc tools,