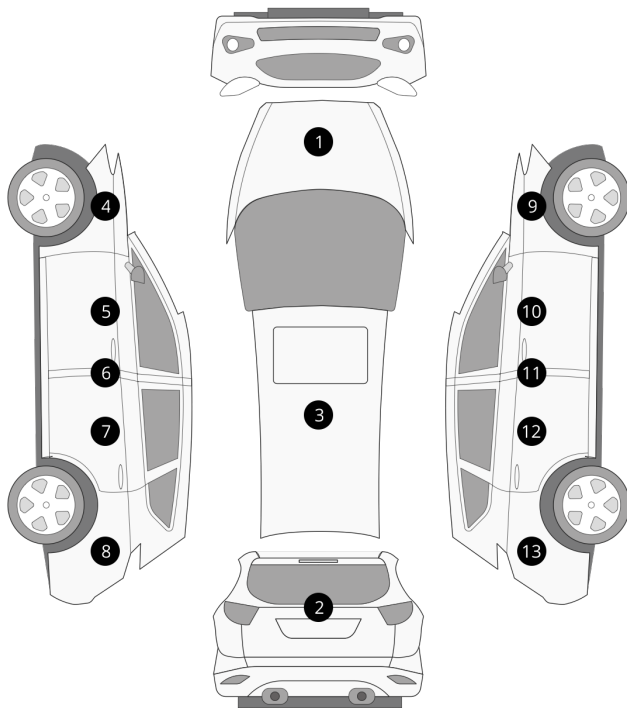


General Information

Date & Time: 14, Apr, 2025 15:09

Make	Toyota	Model	Vios
YOM	2025	Mileage	2,725
Registration No.	NHU3694	Chassis No.	PA1B18F30R4271219
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



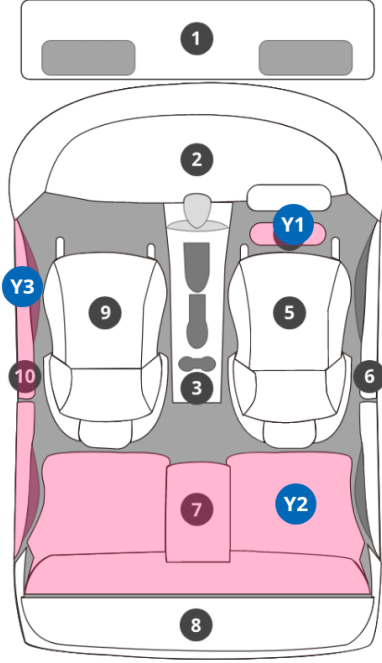
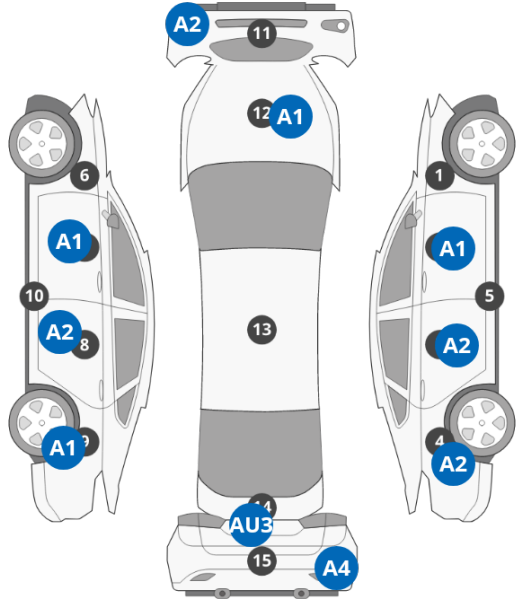
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	109	111	115
2	Boot Lid	104.9	100	108	107
3	Roof	99.3	102	103	93/100
4	Left Front Fender	102.6	92	107	109
5	Left Front Door	105.0	101	101	113
6	Center Panel Left				
7	Left Rear Door	108.7	124	105	97
8	Left Back Panel	108.2	118	108	99
9	Right Front Fender	104.7	114	103	97
10	Right Front Door	85.0	84	85	87
11	Center Panel Right				
12	Right Rear Door	98.8	88	107	102
13	Right Back Panel	102.1	100	97	109

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Medium	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet/with jack/No tools/No spare tire/No LTO plate/ rear parking sensor issue