


General Information

Date & Time: 01, Jul, 2025 17:39

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	20,836
Registration No.	BAF7443	Chassis No.	MHKU3FE10PK006163
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Pickup
Colour	White		

Body / Panel Condition

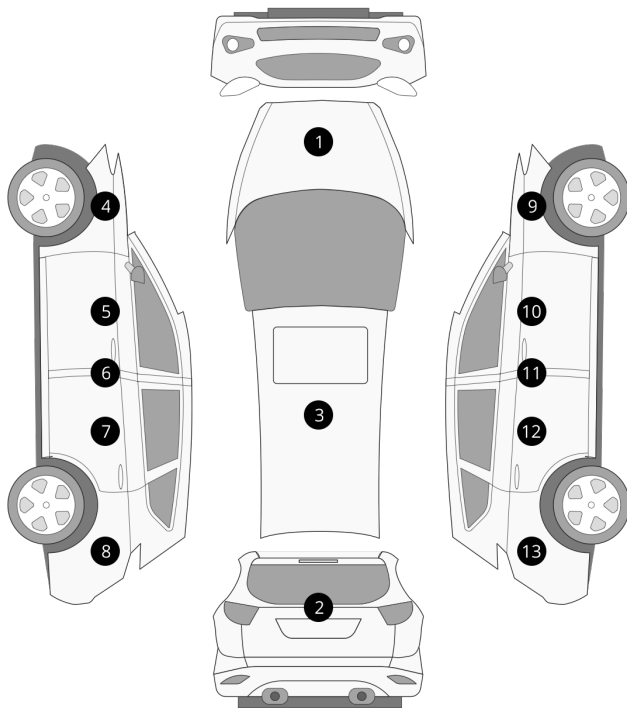

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	59.0	53	65	59
2	Boot Lid	49.1	53	47	47
3	Roof	61.9	56	60	68/63
4	Left Front Fender	46.6	45	47	48
5	Left Front Door	56.4	50	63	56
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	49.1	48	50	49
9	Right Front Fender	61.6	65	63	58
10	Right Front Door	55.9	51	64	53
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	47.2	50	51	41

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	Exterior Evaluation : C A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes	Remarks (R) Front Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch - Small / Rear Gate - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Small / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A Remarks Defects not found	Functional Evaluation : A Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet and LTO plate, Jack and sparetire, Incomplete tools. scratch headlight and tail light.