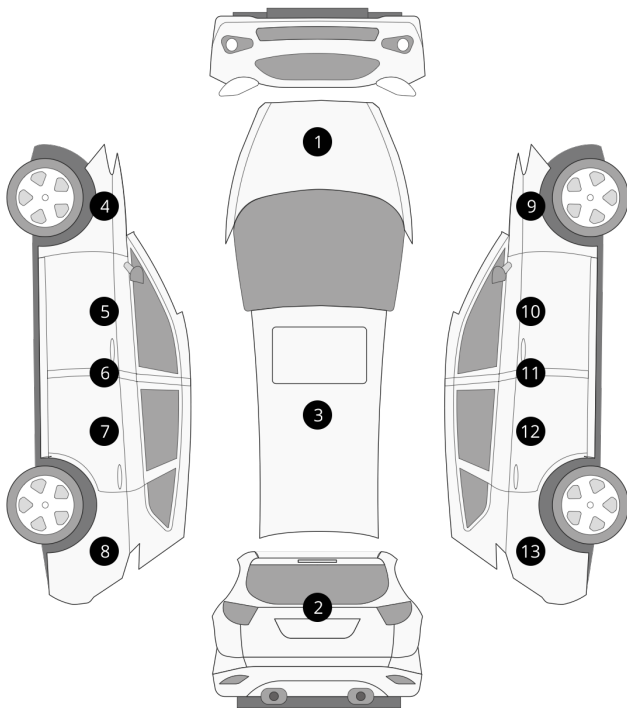


General Information

Date & Time: 21, Jul, 2025 15:43

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,334
Registration No.	DBN3966	Chassis No.	PA1B18F3XP4229024
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



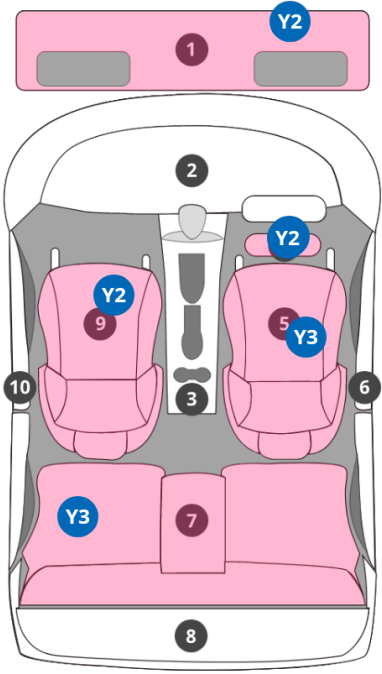
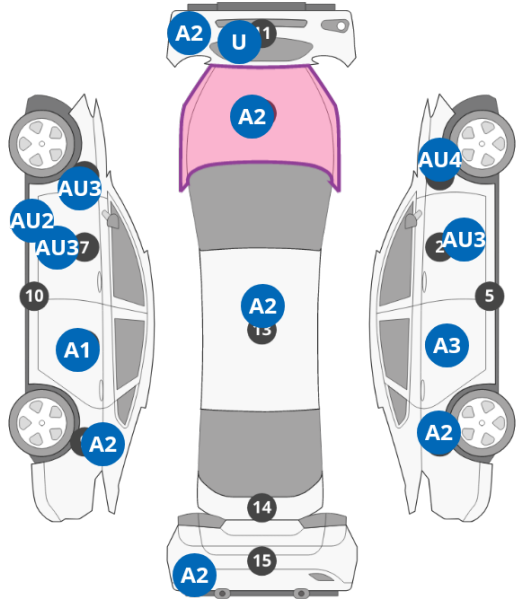
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	169.0	184	161	162
2	Boot Lid	104.7	97	105	112
3	Roof	95.3	92	98	93/99
4	Left Front Fender	92.0	93	90	93
5	Left Front Door	102.3	100	102	105
6	Center Panel Left				
7	Left Rear Door	96.7	100	98	93
8	Left Back Panel	107.6	115	107	101
9	Right Front Fender	96.3	98	94	98
10	Right Front Door	99.4	98	101	100
11	Center Panel Right				
12	Right Rear Door	97.9	98	99	98
13	Right Back Panel	106.3	100	103	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (R) Front Seat - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Sparetire and Jack, Incomplete Tools. no warranty booklet and LTO Plate, scratch headlight and tail light.