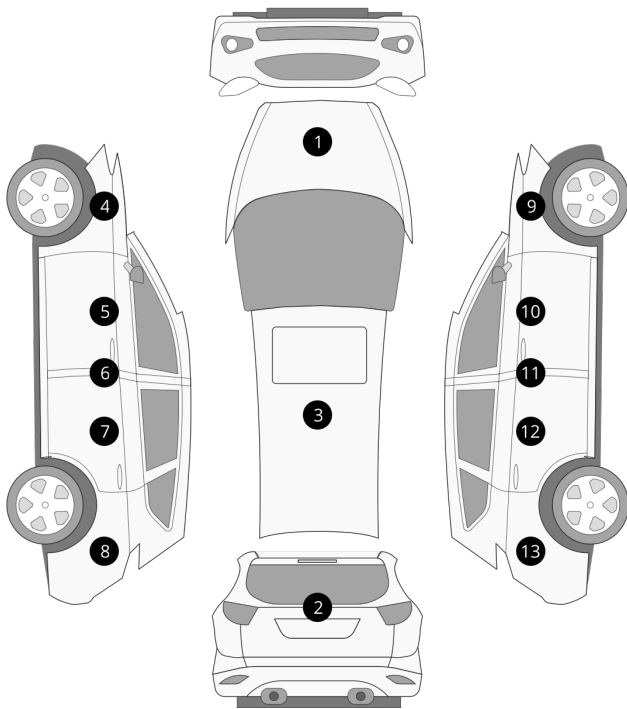


General Information

Date & Time: 18, Jul, 2025 09:37

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	44,313
Registration No.	CBE5284	Chassis No.	PA1B18F34N4168841
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



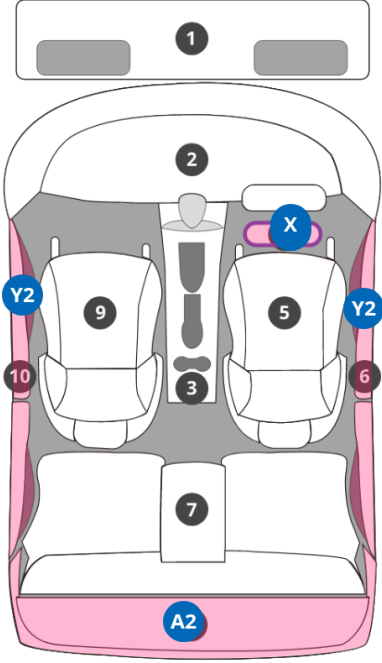
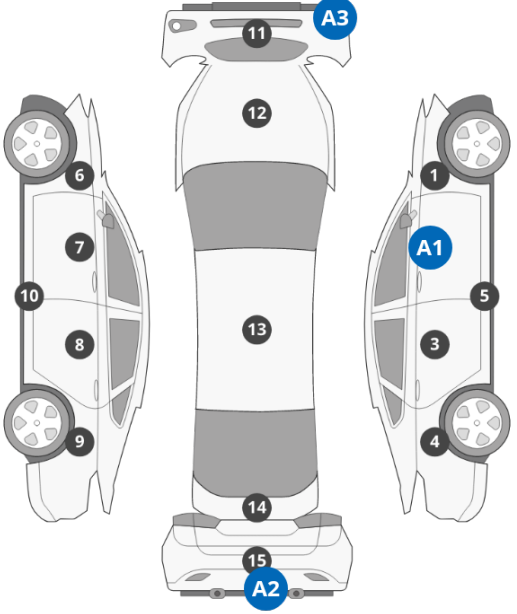
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.6	104	102	117
2	Boot Lid	103.0	100	103	106
3	Roof	89.4	100	87	84/86
4	Left Front Fender	95.8	93	97	98
5	Left Front Door	98.5	98	104	94
6	Center Panel Left				
7	Left Rear Door	99.1	98	98	102
8	Left Back Panel	105.6	114	103	100
9	Right Front Fender	98.1	100	99	96
10	Right Front Door	90.8	89	88	96
11	Center Panel Right				
12	Right Rear Door	95.3	92	95	100
13	Right Back Panel	97.3	93	96	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jackNo tools and No warranty booklet/left and right head light traces of adhesive tape /trunk spare tire cover No carpet /No reverse camera