

General Information

Date & Time: 18, Aug, 2025 08:55

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	22,968
Registration No.	NHS2498	Chassis No.	PA1B18F36R4259219
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



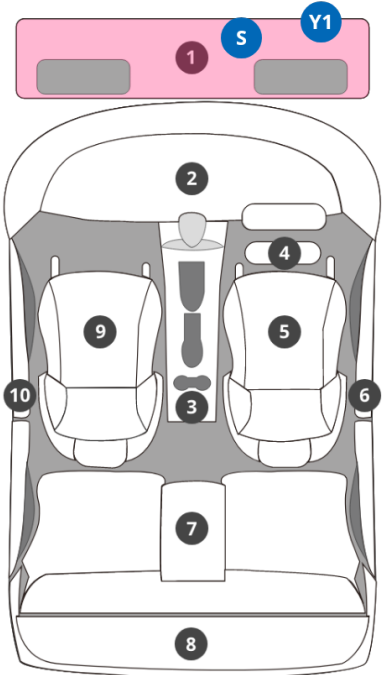
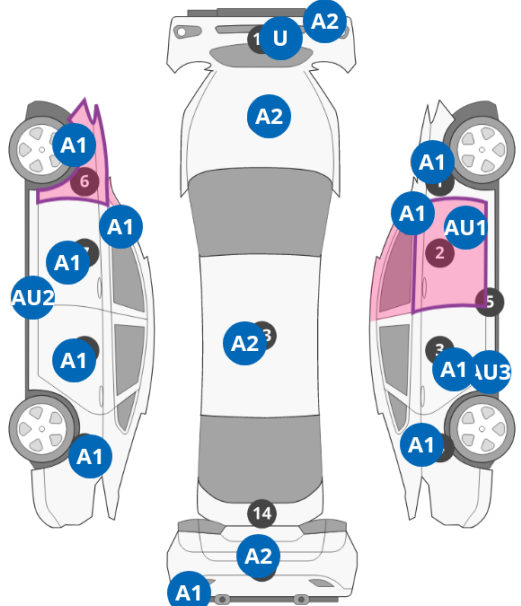
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	127	106	115
2	Boot Lid	112.3	109	115	113
3	Roof	109.0	108	109	108/111
4	Left Front Fender	94.8	92	93	99
5	Left Front Door	102.0	100	101	105
6	Center Panel Left				
7	Left Rear Door	101.5	107	102	96
8	Left Back Panel	124.3	134	129	110
9	Right Front Fender	256.3	327	225	217
10	Right Front Door	185.6	189	186	182
11	Center Panel Right				
12	Right Rear Door	108.0	102	102	120
13	Right Back Panel	114.6	110	102	132

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and warranty booklet and Sparetire, Jack and Incomplete Tools, scratch headlight and tail light.