

General Information

Date & Time: 04, Oct, 2025 18:07

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	17,840
Registration No.	NKI1189	Chassis No.	PA2JA8EM4R0148595
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



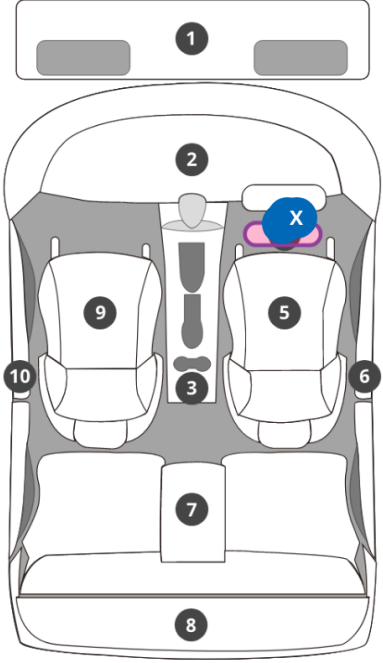
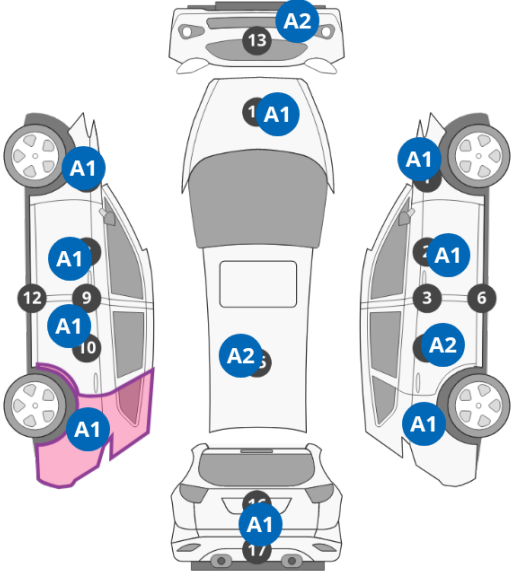
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.5	100	109	90
2	Boot Lid	103.9	98	107	107
3	Roof	90.4	78	89	100/96
4	Left Front Fender	97.7	99	102	93
5	Left Front Door	99.8	99	100	101
6	Center Panel Left				
7	Left Rear Door	98.2	103	101	91
8	Left Back Panel	368.3	122	139	844
9	Right Front Fender	97.2	93	97	102
10	Right Front Door	90.8	93	93	88
11	Center Panel Right				
12	Right Rear Door	93.5	97	91	92
13	Right Back Panel	97.4	91	100	101

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes	Remarks (L) Rear Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Turn Signal, Hazard Flasher - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools and warranty booklet, scratch headlight and tail light, hazard button issue.