

General Information

Date & Time: 14, Nov, 2025 11:12

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	17,595
Registration No.	GBE1418	Chassis No.	PA1B18F36R4250956
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



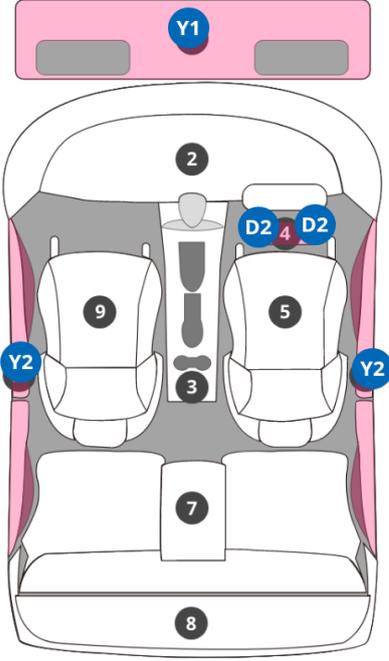
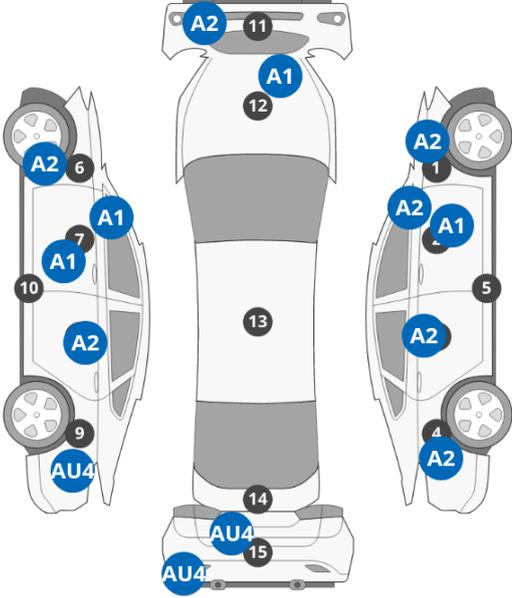
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	109	102	110
2	Boot Lid	129.5	96	183	110
3	Roof	93.9	103	88	84/101
4	Left Front Fender	94.5	95	90	99
5	Left Front Door	104.3	101	111	101
6	Center Panel Left				
7	Left Rear Door	108.0	106	106	112
8	Left Back Panel	108.3	112	107	106
9	Right Front Fender	100.7	102	102	98
10	Right Front Door	98.6	105	95	95
11	Center Panel Right				
12	Right Rear Door	106.8	99	110	111
13	Right Back Panel	105.6	103	100	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large
Frame Evaluation : D	Functional Evaluation : B
Remarks Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
Rear bumper and trunk door damaged. Crack left taillight. Trunk floor missing. Without warranty booklet and tools. With spare tire,jack and seat cover. 3 keys. With LTO plate.