

General Information

Date & Time: 12, Nov, 2025 14:42

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	32,231
Registration No.	NJF3860	Chassis No.	PA2JA8EM9R0151248
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



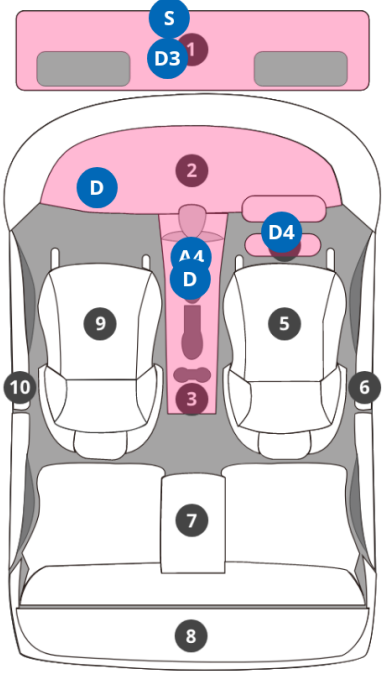
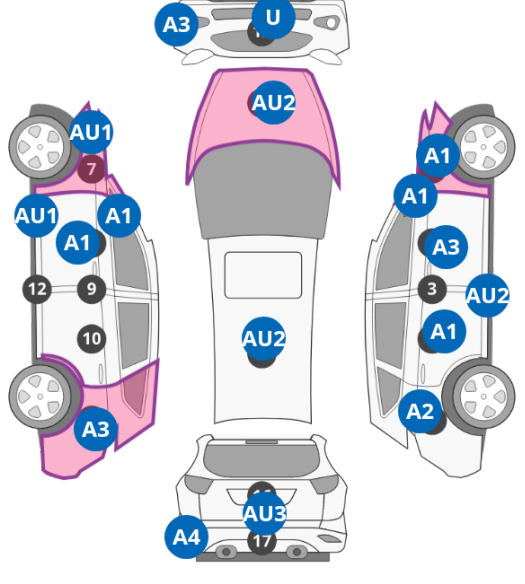
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.3	99	108	98
2	Boot Lid	104.7	111	106	97
3	Roof	98.9	91	86	104/115
4	Left Front Fender	109.6	115	109	105
5	Left Front Door	96.6	99	96	95
6	Center Panel Left				
7	Left Rear Door	103.5	107	105	99
8	Left Back Panel	105.3	102	106	108
9	Right Front Fender	111.3	107	111	116
10	Right Front Door	101.4	107	99	98
11	Center Panel Right				
12	Right Rear Door	102.2	97	103	107
13	Right Back Panel	100.7	98	103	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Large / Knobs - Worn, Peel, Crack - Large / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes / Ceiling - Crinkle - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : C	Functional Evaluation : A
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
With LTO plate and Sparetire, Jack and Warranty booklet, No Tools, Scratch headlight and tail light, foul smell, worn tires and Sparetire, adhesive marks on vehicle, plate and room light issue.