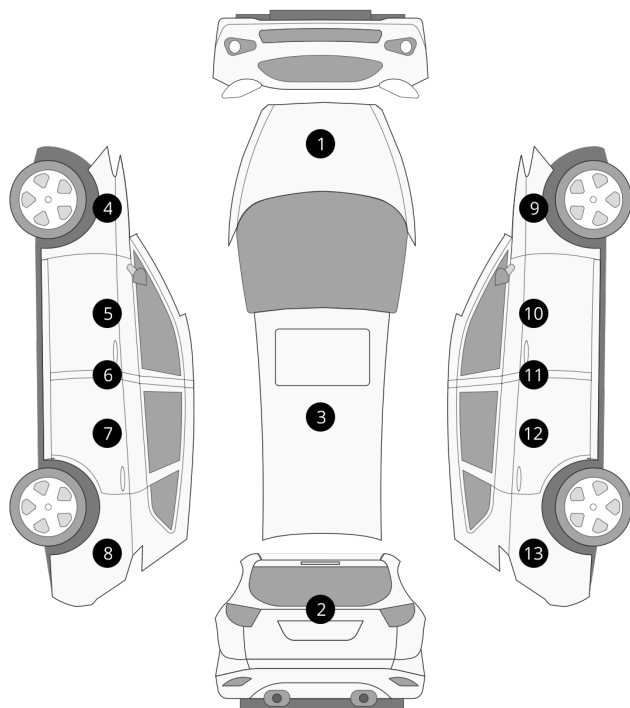


General Information

Date & Time: 15, Nov, 2025 10:13

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	12,643
Registration No.	DBP6359	Chassis No.	PA1B18F32R426126
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



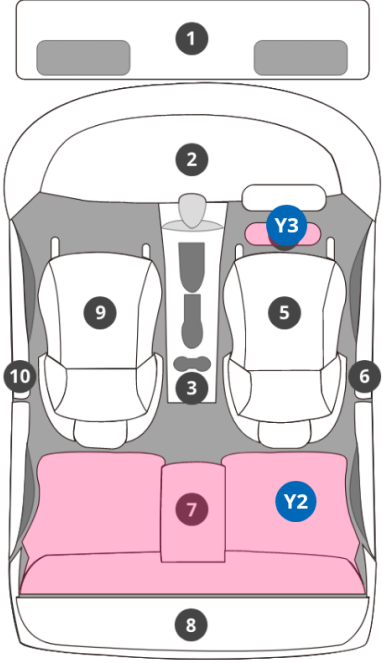
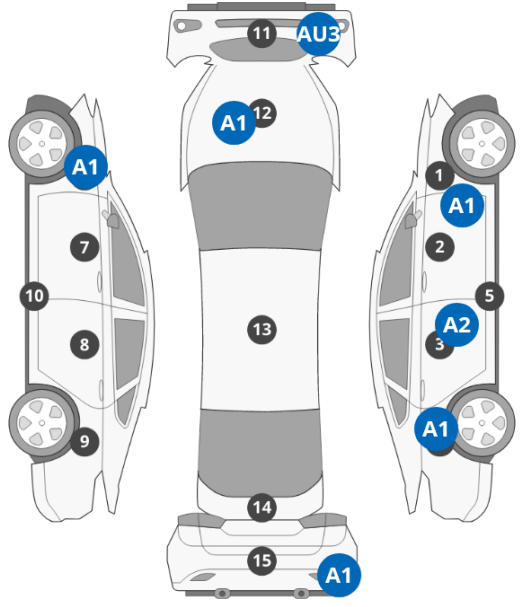
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.3	101	102	107
2	Boot Lid	108.0	108	104	112
3	Roof	91.3	100	91	93/82
4	Left Front Fender	94.7	99	93	92
5	Left Front Door	98.0	93	96	105
6	Center Panel Left				
7	Left Rear Door	100.6	112	95	95
8	Left Back Panel	104.1	112	97	104
9	Right Front Fender	98.5	105	91	100
10	Right Front Door	92.3	90	99	89
11	Center Panel Right				
12	Right Rear Door	97.7	100	96	97
13	Right Back Panel	100.8	100	93	109

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium	Remarks (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

With Lto plate, with warranty booklet, 1key,with jack, No spare tire and tools, scratches headlight