

General Information

Date & Time: 19, Nov, 2025 18:06

Make	Toyota	Model	Camry
YOM	2022	Odo Meter Reading	63,013
Registration No.	NFE1522	Chassis No.	MR2B53HK1N4012832
CC	2.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



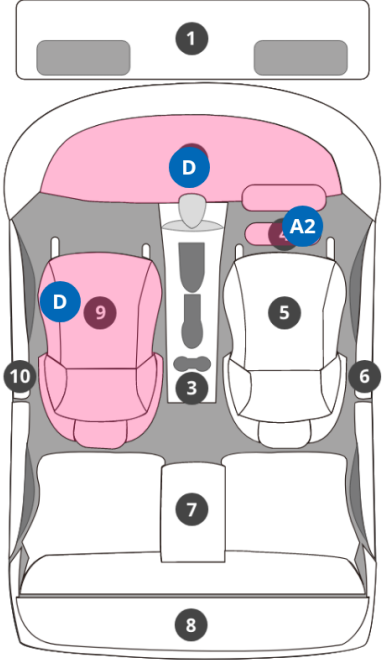
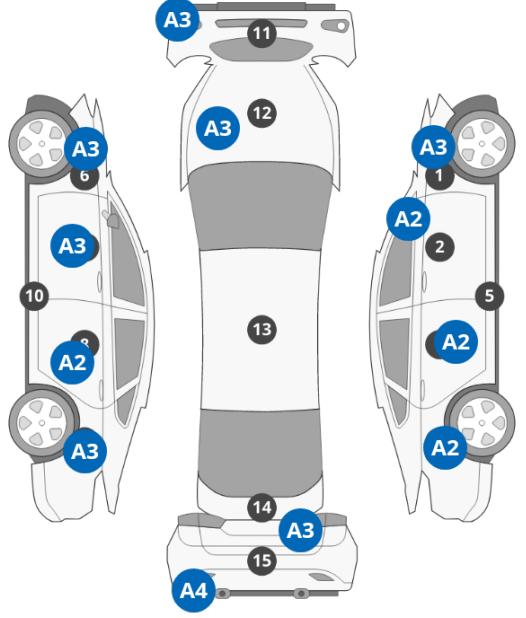
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	107	104	115
2	Boot Lid	113.6	106	120	115
3	Roof	118.5	128	116	107/123
4	Left Front Fender	115.0	117	114	114
5	Left Front Door	120.3	117	122	122
6	Center Panel Left				
7	Left Rear Door	118.0	123	123	108
8	Left Back Panel	114.0	119	106	117
9	Right Front Fender	116.3	112	117	120
10	Right Front Door	113.6	114	114	113
11	Center Panel Right				
12	Right Rear Door	115.0	107	114	124
13	Right Back Panel	115.0	99	117	129

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Mat Other - Cut, Crack - Small / (L) Front Seat - Worn - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes

Inspector Notes
driver window switch issue/ tire pressure monitoring system light on/ with warranty booklet/ with spare tire and jack/ with tools and LTO plate