

General Information

Date & Time: 05, Dec, 2025 15:52

Make	Ford	Model	Territory
YOM	2021	Odo Meter Reading	51,500
Registration No.	NGA6738	Chassis No.	LJXCU2BBXLTP24939
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



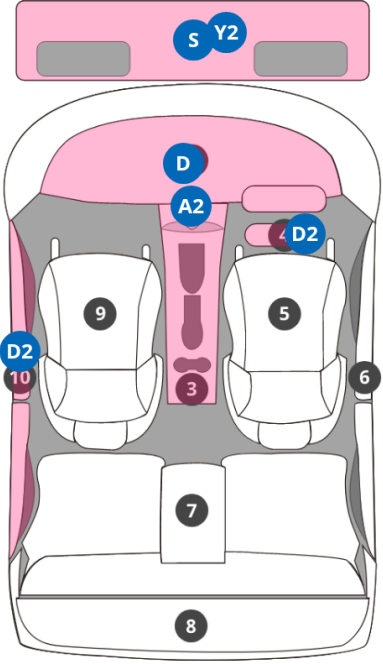
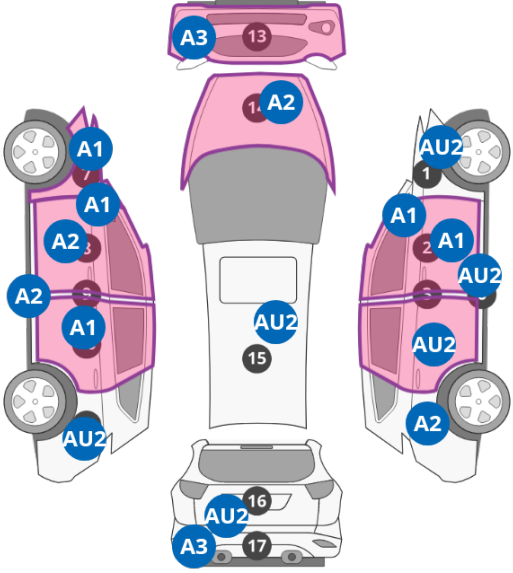
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	147.3	117	135	190
2	Boot Lid	112.6	106	122	110
3	Roof	108.6	94	106	129/106
4	Left Front Fender	233.0	275	225	199
5	Left Front Door	126.6	131	133	116
6	Center Panel Left				
7	Left Rear Door	115.0	112	112	121
8	Left Back Panel	138.0	129	136	149
9	Right Front Fender	131.6	118	138	139
10	Right Front Door	106.6	107	112	101
11	Center Panel Right				
12	Right Rear Door	117.6	103	126	124
13	Right Back Panel	132.3	138	141	118

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal
Frame Evaluation : C	Functional Evaluation : E
Remarks Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, scratch headlight and tail light, Worn Tires and Sparetire, Foul smell, possible flooded and, Warning lamps on, Aircon issue, Abnormal vibration on engine, plate light issue and room light issue, headlight and tail light issue.