

General Information

Date & Time: 11, Dec, 2025 15:58

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	40,355
Registration No.	BAH2229	Chassis No.	JTNAFAP3S8053062
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



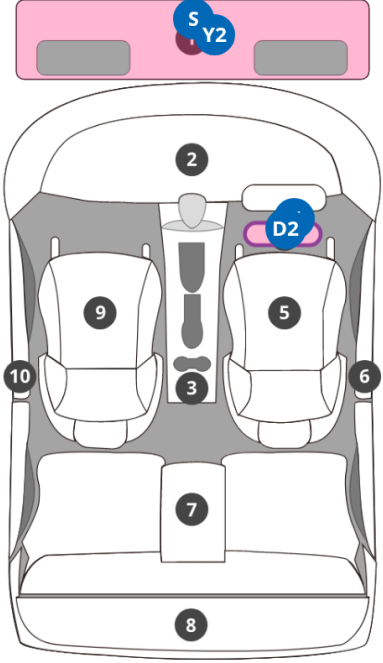
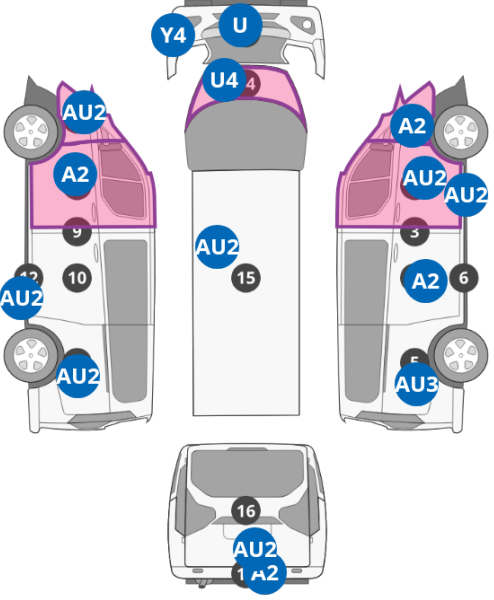
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	76.1	75	77	76
2	Boot Lid	65.1	64	66	66
3	Roof	79.6	78	76	101/64
4	Left Front Fender	74.5	80	74	69
5	Left Front Door	71.6	76	75	64
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	63.8	63	63	66
9	Right Front Fender	82.7	78	86	85
10	Right Front Door	76.5	69	79	82
11	Center Panel Right				
12	Right Rear Door	70.7	69	75	68
13	Right Back Panel	76.0	77	76	75

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Mat Other - Missing - Yes / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : E
Remarks Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Parking Brake - Function - Weak / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire and Jack and Incomplete Tools, with warranty booklet, scratch headlight and tail light, Worn Tires and Sparetire, No spare key, Abnormal noise, foul smell, hood cannot open, plate light issue and room light issue, headlight and tail light crack, adhesive marks on vehicle, Abnormal vibration, Abnormal shiftshock.