

General Information

Date & Time: 17, Jan, 2026 11:18

Make	Toyota	Model	Vios
YOM	2018	Odo Meter Reading	46,476
Registration No.	NBS9181	Chassis No.	PA1B23F33J6005122
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



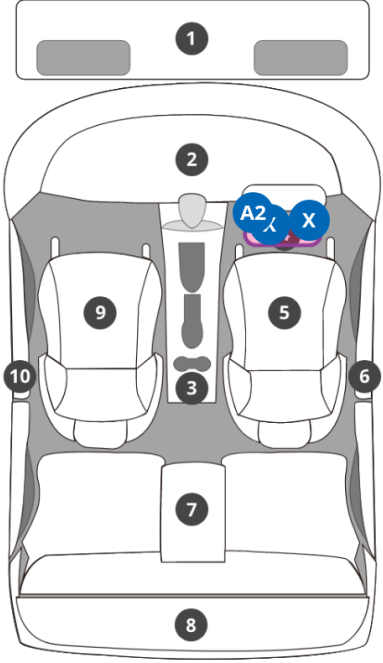
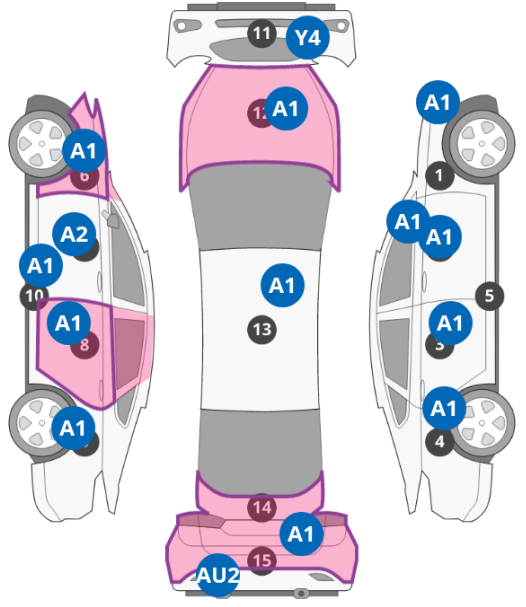
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	249.6	247	245	257
2	Boot Lid	162.3	185	137	165
3	Roof	92.8	98	92	89/93
4	Left Front Fender	313.6	542	232	167
5	Left Front Door	129.3	134	128	126
6	Center Panel Left				
7	Left Rear Door	155.6	154	128	185
8	Left Back Panel	105.4	112	98	106
9	Right Front Fender	103.0	109	102	98
10	Right Front Door	99.1	97	99	102
11	Center Panel Right				
12	Right Rear Door	99.5	101	99	99
13	Right Back Panel	139.3	145	130	143

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Small	Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large
Frame Evaluation : B	Functional Evaluation : A
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with jack, 1key, no warranty booklet, no spare tire and tools, scratches and crack headlight and taillight