

General Information

Date & Time: 22, Jan, 2026 15:45

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	129,145
Registration No.	NEM6315	Chassis No.	PA1B18F37M4152138
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



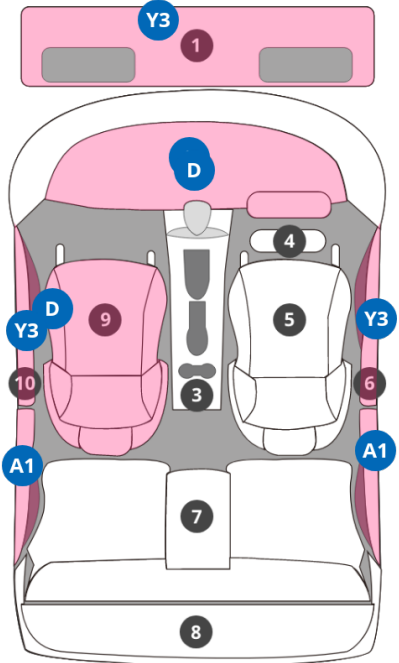
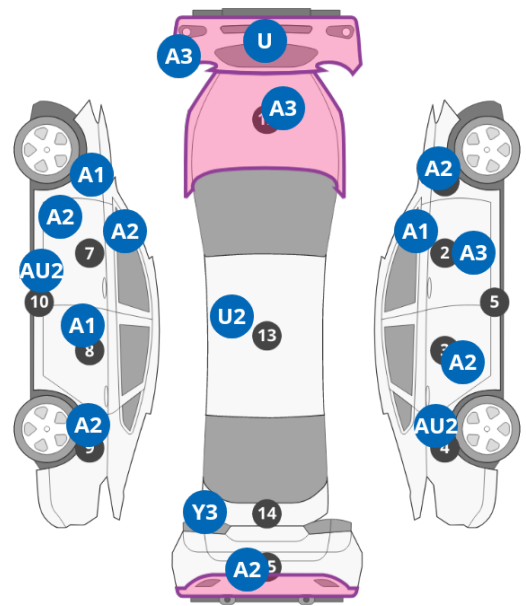
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	112	101	129
2	Boot Lid	125.0	109	107	159
3	Roof	96.2	108	88	87/102
4	Left Front Fender	95.2	89	94	103
5	Left Front Door	105.0	101	114	100
6	Center Panel Left				
7	Left Rear Door	98.1	103	98	94
8	Left Back Panel	126.3	134	118	127
9	Right Front Fender	88.4	87	92	86
10	Right Front Door	98.7	97	96	103
11	Center Panel Right				
12	Right Rear Door	100.9	93	99	111
13	Right Back Panel	101.3	100	99	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (L) Rear Trim - Cut, Crack - Minimal / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch - Medium / Roof - Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, plate light issue, air blower switch issue, possible flooding, door lock master switch issue,</p>