

General Information

Date & Time: 24, Feb, 2026 09:45

Make	Toyota	Model	Lite Ace
YOM	2023	Odo Meter Reading	34,940
Registration No.	FAO5992	Chassis No.	MHKU3FE10PK003764
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



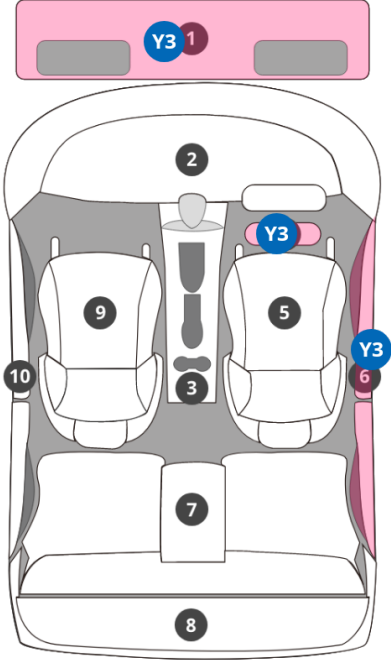
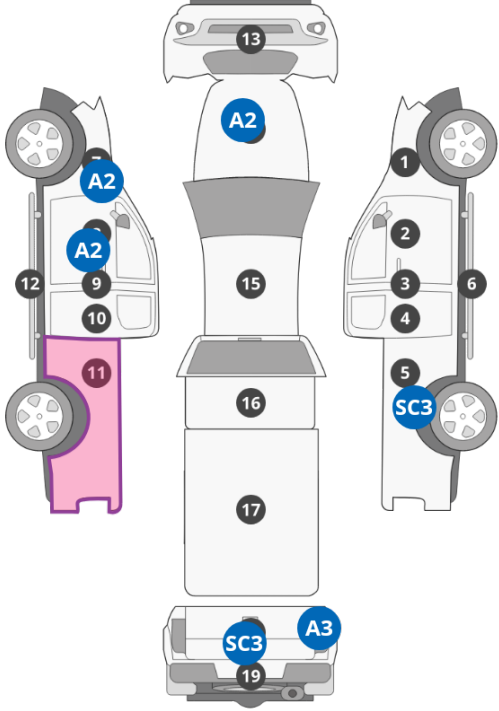
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	57.8	61	55	58
2	Boot Lid	66.4	68	44	87
3	Roof				
4	Left Front Fender	54.4	57	52	55
5	Left Front Door	51.5	55	50	50
6	Center Panel Left	61.4	66	58	60
7	Left Rear Door				
8	Left Back Panel	60.1	50	63	67
9	Right Front Fender	58.9	62	55	60
10	Right Front Door	55.0	51	53	61
11	Center Panel Right	55.9	57	49	62
12	Right Rear Door				
13	Right Back Panel	56.8	56	47	67

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / Ceiling - Grime - Medium / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Side Gate - Rust, Corrosion - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Rear Gate - Rust, Corrosion - Medium / (L) Side Gate - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Panel - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes</p>

<p>Inspector Notes</p>
<p>Busted Left Break light. With 2 spare key. with spare tire. no jack and tools. with warranty booklet. no seat cover</p>