

General Information

Date & Time: 19, Feb, 2026 16:08

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,415
Registration No.	NEY3200	Chassis No.	PA1B18F32R4254101
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



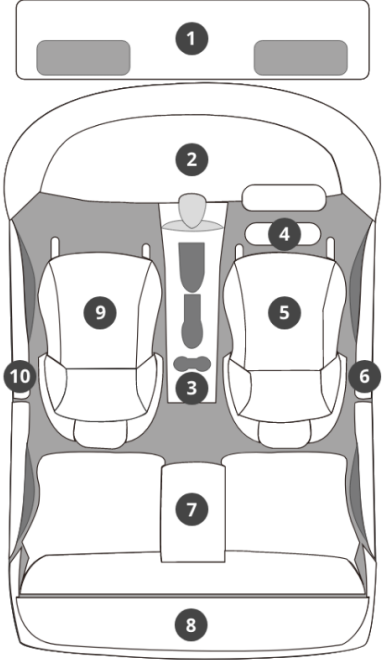
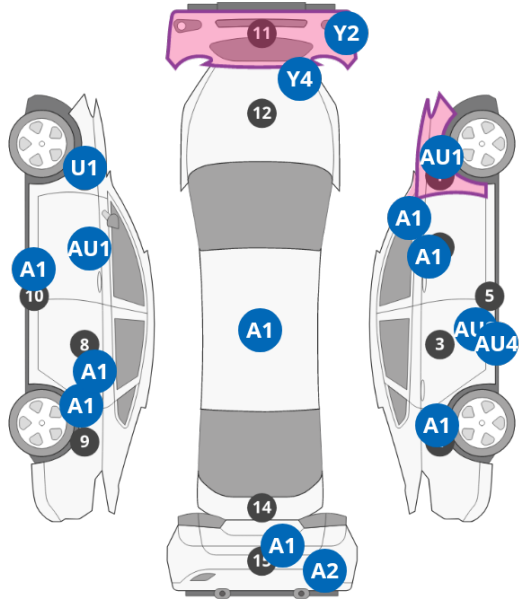
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	112	110	107
2	Boot Lid	182.6	189	168	191
3	Roof	96.1	100	91	97/97
4	Left Front Fender	99.1	100	98	100
5	Left Front Door	97.8	100	100	94
6	Center Panel Left				
7	Left Rear Door	105.0	105	102	108
8	Left Back Panel	108.0	118	100	106
9	Right Front Fender	254.0	92	180	490
10	Right Front Door	107.5	94	93	135
11	Center Panel Right				
12	Right Rear Door	98.1	93	98	104
13	Right Back Panel	101.7	105	93	107

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Dent - Minimal / Bonnet, Headlight - Crack, Gap - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, Crack headlight, scratches on taillights,