

General Information

Date & Time: 24, Feb, 2026 16:19

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	33,144
Registration No.	NIO8088	Chassis No.	PA1B18F35S4284957
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



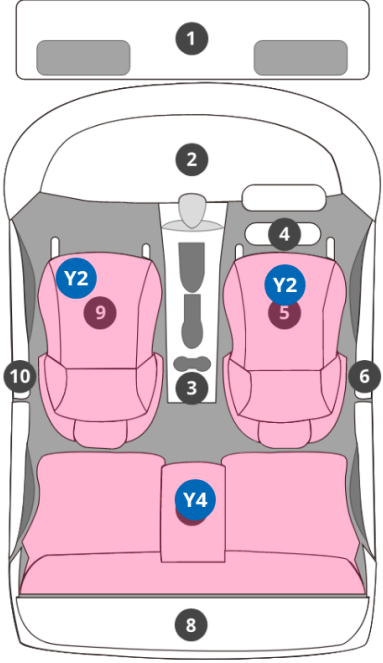
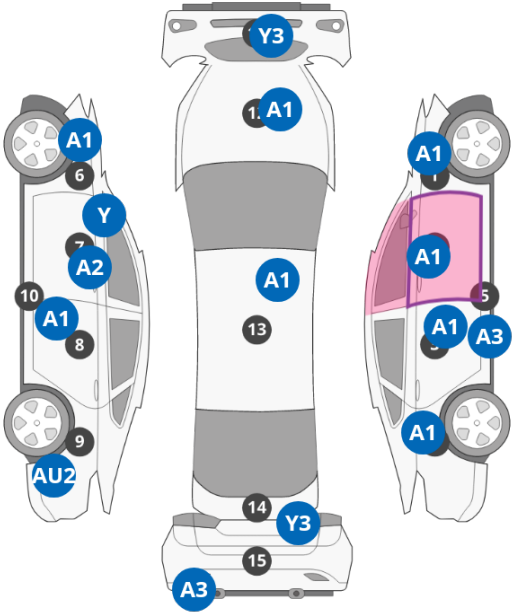
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	115	103	114
2	Boot Lid	113.5	118	100	123
3	Roof	88.7	88	90	87/90
4	Left Front Fender	96.0	96	97	96
5	Left Front Door	98.0	102	94	98
6	Center Panel Left				
7	Left Rear Door	113.3	127	106	107
8	Left Back Panel	110.0	110	112	108
9	Right Front Fender	95.8	98	94	96
10	Right Front Door	132.6	129	131	138
11	Center Panel Right				
12	Right Rear Door	100.2	96	101	104
13	Right Back Panel	98.0	94	101	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Partially Missing - Yes / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Medium / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Crack - Cracks / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire, with jack and tools, 1key, no warranty booklet, scratches on headlights, Crack taillight, battery weak</p>