

General Information

Date & Time: 02, Mar, 2026 17:41

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	206,428
Registration No.	DAU9876	Chassis No.	PA1B18F37M4142676
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



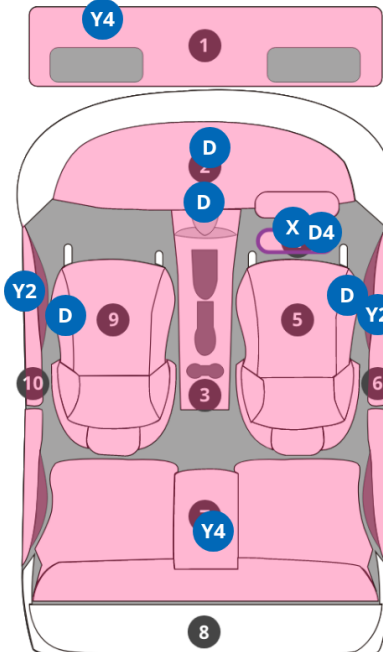
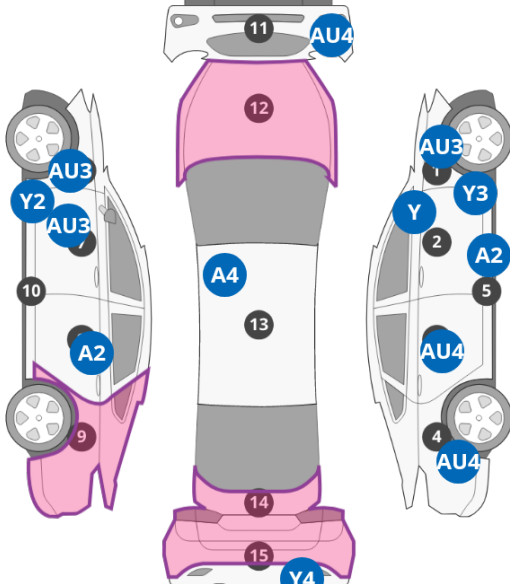
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	267.6	415	172	216
2	Boot Lid	144.1	92	177	163
3	Roof	104.2	120	99	101/97
4	Left Front Fender	100.3	99	105	98
5	Left Front Door	115.3	111	119	116
6	Center Panel Left				
7	Left Rear Door	105.6	107	103	107
8	Left Back Panel	134.3	151	104	148
9	Right Front Fender	101.1	104	99	100
10	Right Front Door	107.3	113	105	104
11	Center Panel Right				
12	Right Rear Door	109.6	105	107	117
13	Right Back Panel	153.3	181	141	138

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Rear Seat - Grime - Large / Console, Switches, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Crack - Damaged / (R) Front Door, Molding - Crack, Gap - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Fender, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Repair mark - Difference in Color / Roof - Scratch - Large</p>
Frame Evaluation : B	Functional Evaluation : D
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No warranty booklet, No original LTO plate, crack on windshield, no tools, scratches on headlights, and taillights, possible flooded</p>