

General Information

Date & Time: 23, May, 2026 19:50

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	50,093
Registration No.	KBA6018	Chassis No.	PAHACACA6S6420504
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



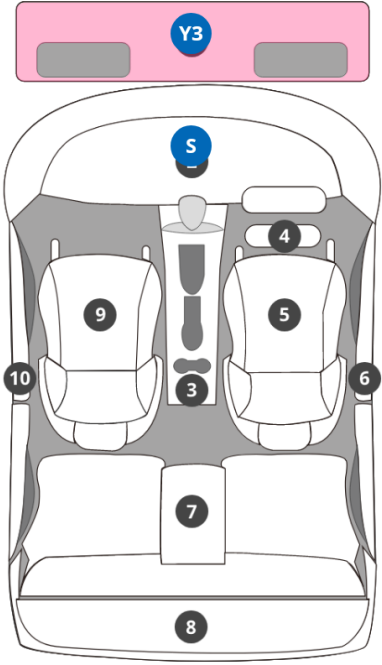
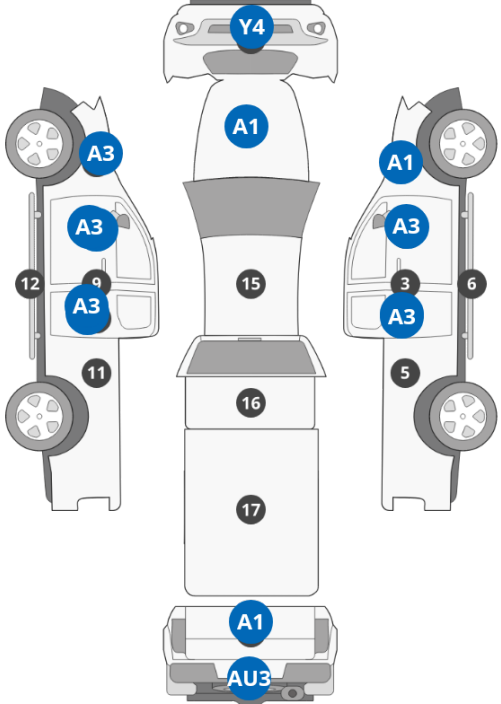
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	149.3	166	155	127
2	Boot Lid	52.5	59	51	48
3	Roof	98.1	144	121	66/62
4	Left Front Fender	111.3	116	115	103
5	Left Front Door	100.2	103	103	95
6	Center Panel Left	80.8	76	81	85
7	Left Rear Door	74.9	77	70	78
8	Left Back Panel	74.8	67	74	83
9	Right Front Fender	105.3	105	105	106
10	Right Front Door	98.3	93	102	100
11	Center Panel Right	73.4	78	72	71
12	Right Rear Door	60.6	61	63	58
13	Right Back Panel	56.5	52	55	63

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Overall Interior - Smell - Yes	Remarks Bonnet - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Corner Panel - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Corner Panel - Scratch - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate, no warranty booklet, incomplete tools, with jack, with spare tire, no spare key, no reverse camera, with hairline scratches, loosen fuel cover, with foul smell, damaged one rear window side lock.