

General Information

Date & Time: 11, Jul, 2026 14:49

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	60,763
Registration No.	NHS3842	Chassis No.	MHFAB1BYXR3103322
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



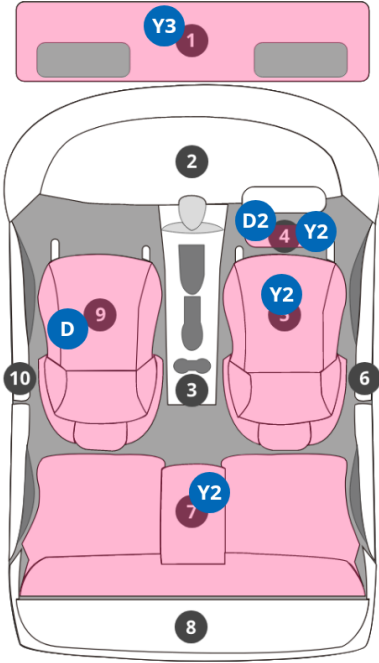
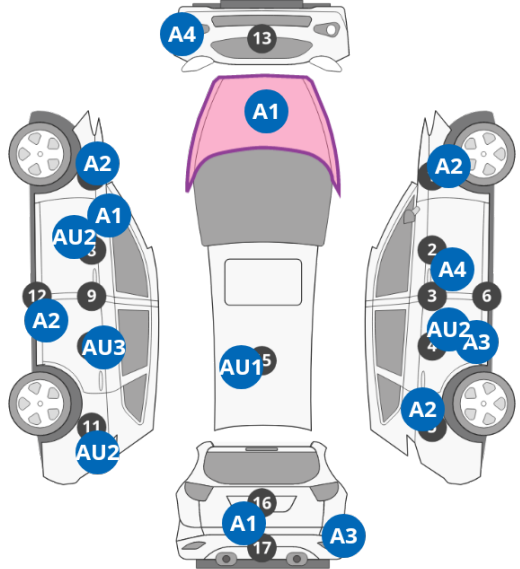
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	171.3	152	196	166
2	Boot Lid	109.0	108	116	103
3	Roof	119.2	124	129	113/111
4	Left Front Fender	105.0	105	104	106
5	Left Front Door	122.6	116	125	127
6	Center Panel Left				
7	Left Rear Door	119.6	123	115	121
8	Left Back Panel	116.6	131	116	103
9	Right Front Fender	104.2	106	109	98
10	Right Front Door	120.3	122	123	116
11	Center Panel Right				
12	Right Rear Door	117.0	119	114	118
13	Right Back Panel	114.0	105	109	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/no warranty booklet/with incomplete tools with jack/wih spare tire/sign of overheating/audio radio issue/fog light issue/plate light issue/no spare key/scratches on taillight cover/aircon weak/bulge on tire/hairline scratches on the body