

General Information

Date & Time: 20, Jul, 2026 15:33

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	24,833
Registration No.	NKQ3700	Chassis No.	JTFNAFAP8S8053476
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



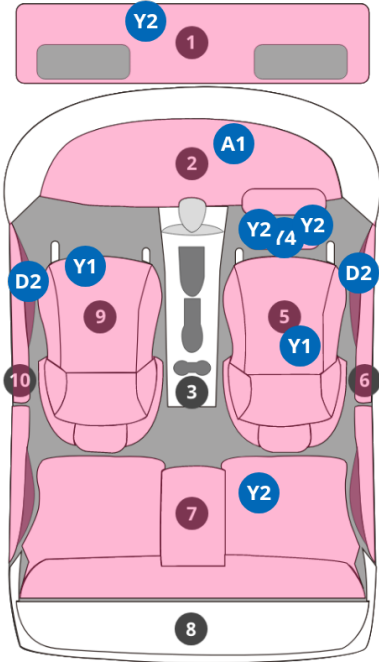
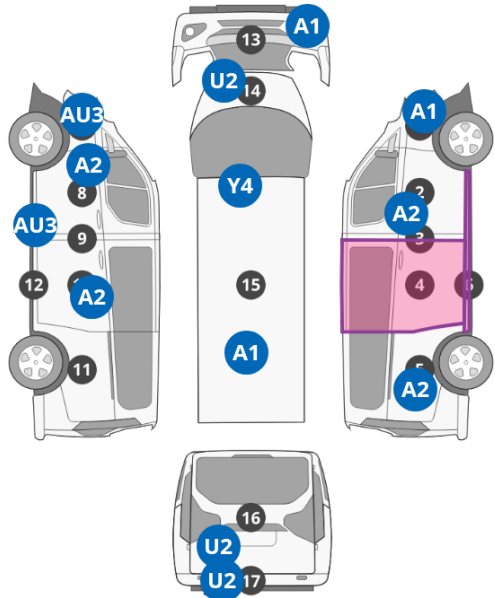
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	79.1	79	78	80
2	Boot Lid	74.9	76	69	80
3	Roof	66.0	68	60	68/68
4	Left Front Fender	80.6	82	84	76
5	Left Front Door	78.5	82	78	75
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	72.9	70	79	69
9	Right Front Fender	81.1	77	76	90
10	Right Front Door	80.3	80	83	78
11	Center Panel Right	84.5	84	93	76
12	Right Rear Door	76.3	75	83	71
13	Right Back Panel	81.4	79	82	84

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Rear Seat - Grime - Small	Remarks Front Windshield - Damaged - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with Ito plate/with warranty booklet/with spare tire/with tools and jack/with hairlines scratches on the body/tail light damage/without spare key/with reverse camera/power window master switch issue/windshield damage