

General Information

Date & Time: 20, Jul, 2026 15:22

Make	Honda	Model	City
YOM	2018	Odo Meter Reading	97,806
Registration No.	DAG1452	Chassis No.	PADGM6630JV414157
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	White		

Body / Panel Condition



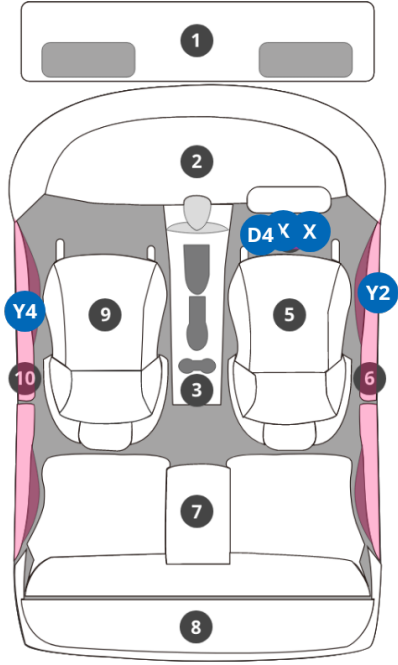
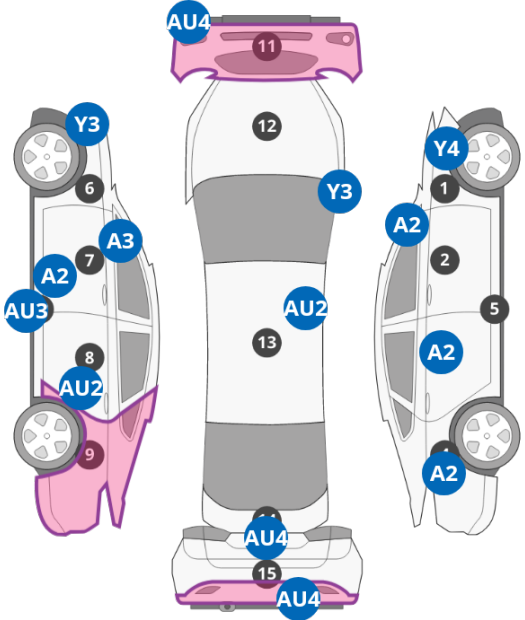
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	85.0	82	85	88
2	Boot Lid	402.6	340	198	670
3	Roof	104.4	110	118	87/103
4	Left Front Fender	85.7	84	81	92
5	Left Front Door	94.6	98	89	97
6	Center Panel Left				
7	Left Rear Door	90.7	99	84	89
8	Left Back Panel	173.3	243	146	131
9	Right Front Fender	82.1	84	82	81
10	Right Front Door	95.8	95	89	104
11	Center Panel Right				
12	Right Rear Door	101.1	101	95	107
13	Right Back Panel	99.8	94	107	99

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Crinkle - Large / Overall Interior - Worn as per age - Yes / (L) Front Trim - Grime - Large / (R) Front Trim - Grime - Small	Remarks (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Crack, Gap - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Crack, Gap - Large / Bonnet, Headlight - Crack, Gap - Medium / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Medium / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no jack and tools/ light scratches around the exterior/ possible flooding/ fog light issue/ seat belt issue/ airbag warning light on/ no spare tire/ with LTO plate and warranty booklet/