

General Information

Date & Time: 22, Jul, 2026 07:34

Make	Mitsubishi	Model	Mirage
YOM	2026	Odo Meter Reading	8,616
Registration No.	NJG3169	Chassis No.	PAEA13RJTSA017495
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



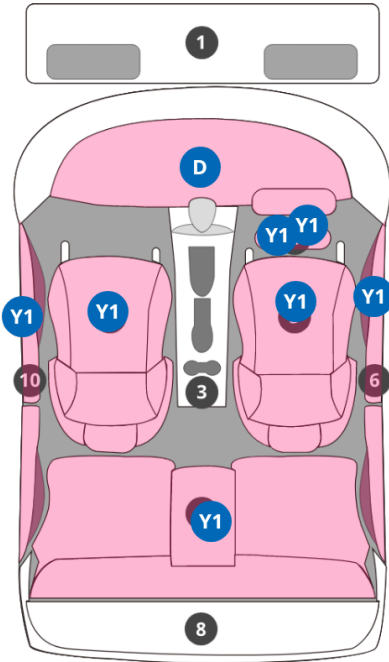
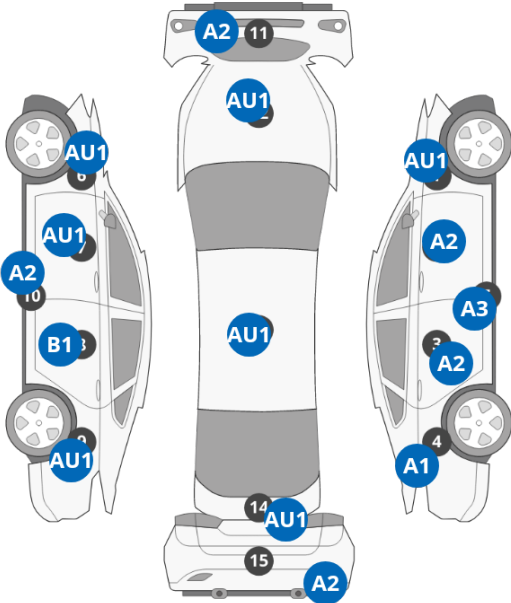
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.0	92	107	104
2	Boot Lid	113.0	122	107	110
3	Roof	115.5	117	112	117/116
4	Left Front Fender	108.8	94	119	113
5	Left Front Door	116.0	116	117	115
6	Center Panel Left				
7	Left Rear Door	112.6	116	112	110
8	Left Back Panel	122.6	128	120	120
9	Right Front Fender	115.3	120	113	113
10	Right Front Door	125.6	139	119	119
11	Center Panel Right				
12	Right Rear Door	117.3	119	115	118
13	Right Back Panel	114.3	119	113	111

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes		Remarks Roof - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Modified - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with LTO plate, with spare tire, with jack and incomplete tools, no spare key, no warranty and manual booklet, no reverse camera, minor scratches and dent on exterior, scratches in taillight and headlight.