

General Information

Date & Time: 22, Jul, 2026 07:35

Make	Mitsubishi	Model	Xpander Cross
YOM	2025	Odo Meter Reading	26,950
Registration No.	NJQ4893	Chassis No.	MK2XRNC1WSN018317
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Gray		

Body / Panel Condition



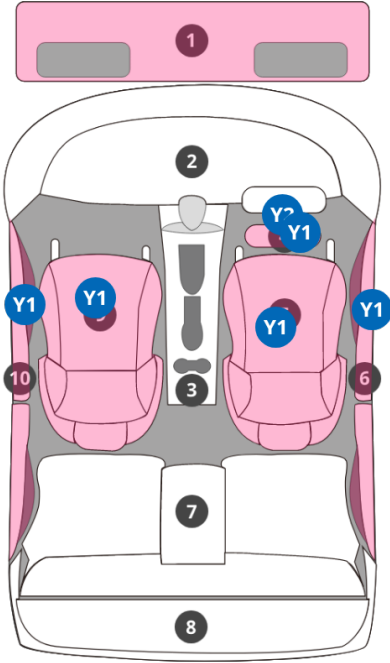
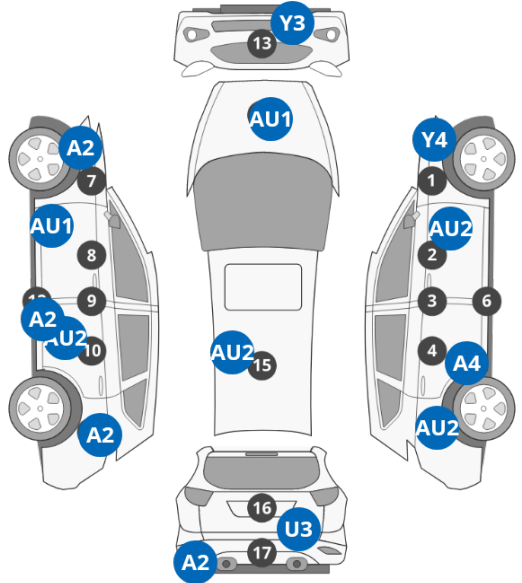
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	108	99	120
2	Boot Lid	92.8	93	86	100
3	Roof	114.7	126	107	119/107
4	Left Front Fender	103.3	109	122	79
5	Left Front Door	112.6	113	110	115
6	Center Panel Left				
7	Left Rear Door	107.6	112	107	104
8	Left Back Panel	114.3	118	111	114
9	Right Front Fender	99.3	102	98	98
10	Right Front Door	112.6	112	115	111
11	Center Panel Right				
12	Right Rear Door	104.0	108	100	104
13	Right Back Panel	108.0	111	104	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Switches - Missing - Yes	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Crack, Gap - Large / Bonnet, Headlight - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate,with jack, with reverse camera, with warranty booklet, no spare key, no manual booklet, issue in headlight and taillight crack lens, issue in dash indicator lamp on,scratches and dent on exterior, scratches in taillight and headlight.