

General Information

Date & Time: 22, Jul, 2026 07:36

Make	Mitsubishi	Model	Mirage
YOM	2026	Odo Meter Reading	7,175
Registration No.	NLA5898	Chassis No.	PAEA13RXTSA002487
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



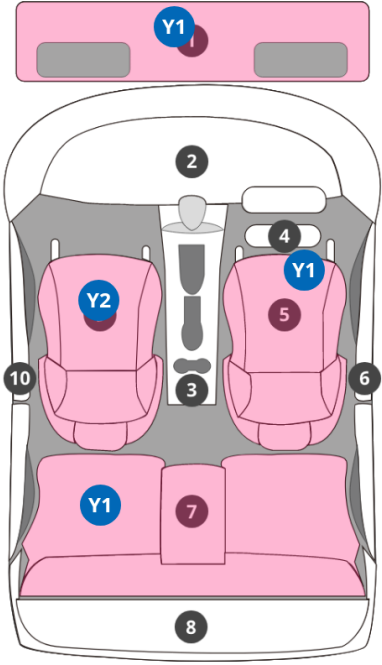
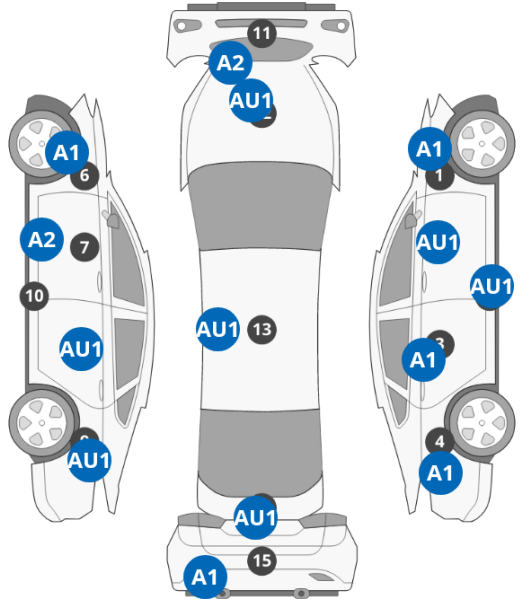
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.6	147	157	148
2	Boot Lid	120.0	123	117	120
3	Roof	120.2	118	124	118/121
4	Left Front Fender	115.3	152	96	98
5	Left Front Door	121.3	122	122	120
6	Center Panel Left				
7	Left Rear Door	115.3	124	117	105
8	Left Back Panel	131.0	137	127	129
9	Right Front Fender	120.0	127	117	116
10	Right Front Door	127.6	136	125	122
11	Center Panel Right				
12	Right Rear Door	125.0	124	123	128
13	Right Back Panel	132.6	147	128	123

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal	Remarks Roof - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate, with spare tire and key, with jack and inc tools, with reverse camera, no warranty and manual booklet, minor scratches on exterior, minor scratches in taillight and headlight.