

General Information

Date & Time: 04, Mar, 2025 14:00

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,151
Registration No.	DBF7514	Chassis No.	PA1B18F3XR4249051
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



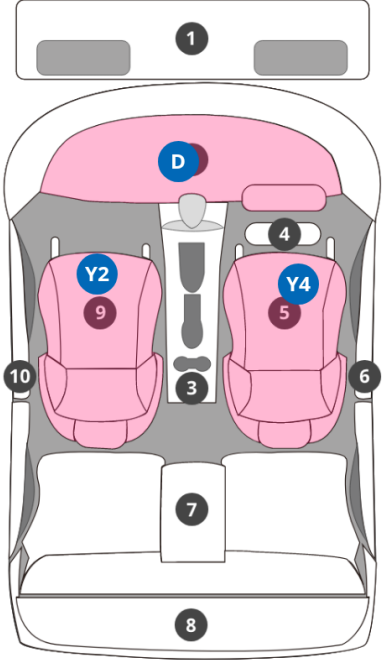
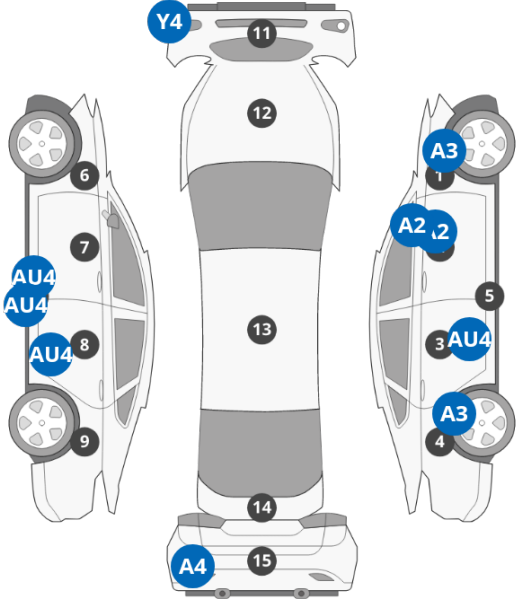
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.0	119	108	109
2	Boot Lid	101.9	99	101	106
3	Roof	114.7	122	106	118/113
4	Left Front Fender	111.0	116	111	106
5	Left Front Door	109.6	108	116	105
6	Center Panel Left				
7	Left Rear Door	106.3	109	103	107
8	Left Back Panel	115.3	115	114	117
9	Right Front Fender	104.6	109	105	100
10	Right Front Door	104.3	105	107	101
11	Center Panel Right				
12	Right Rear Door	114.3	117	116	110
13	Right Back Panel	113.6	110	118	113

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with jack and spare tire/ with LTO plate/ no tools