

General Information

Date & Time: 22, Jul, 2026 07:46

Make	Mitsubishi	Model	L300
YOM	2026	Odo Meter Reading	25,876
Registration No.	NKT5152	Chassis No.	PAEL65NYTSB007734
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



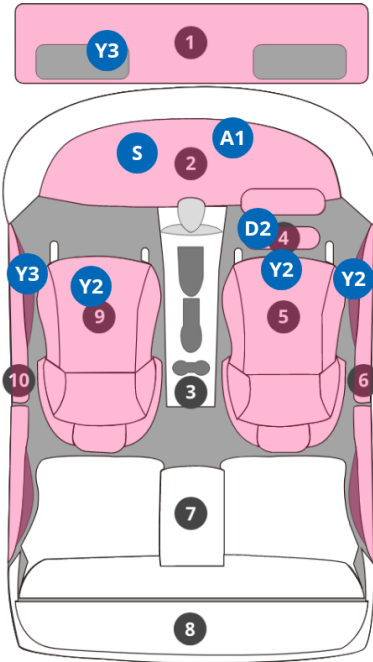
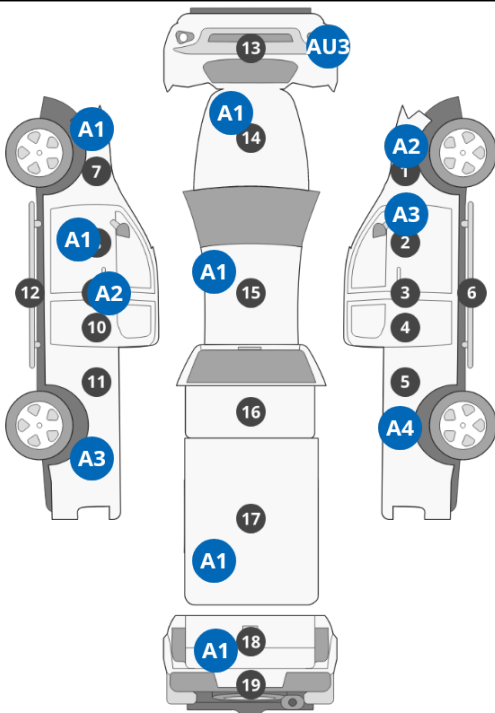
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	72.8	72	74	73
2	Boot Lid	82.2	84	80	83
3	Roof	71.5	68	68	76/75
4	Left Front Fender	82.0	74	79	94
5	Left Front Door	69.7	69	68	73
6	Center Panel Left	81.7	83	83	80
7	Left Rear Door				
8	Left Back Panel	88.7	93	84	90
9	Right Front Fender	76.0	72	78	78
10	Right Front Door	71.4	71	69	75
11	Center Panel Right	76.5	74	81	76
12	Right Rear Door				
13	Right Back Panel	99.7	86	102	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : C	
			
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Sunvisor, Sunglass Holder - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Minimal		Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Large / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch - Minimal / (L) Side Gate - Scratch - Medium / (L) Center Panel - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Front Panel - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : A	
Remarks Defects not found		Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with Ito plate/with warranty booklet/with spare tire/with hairlines scratches on the body/with spare key/without tools and jack/without reverse camera