

General Information

Date & Time: 22, Jul, 2026 15:31

Make	Mitsubishi	Model	ASX
YOM	2015	Odo Meter Reading	114,900
Registration No.	NDU1605	Chassis No.	JMYXTGA2WFZC00716
CC	2.0	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



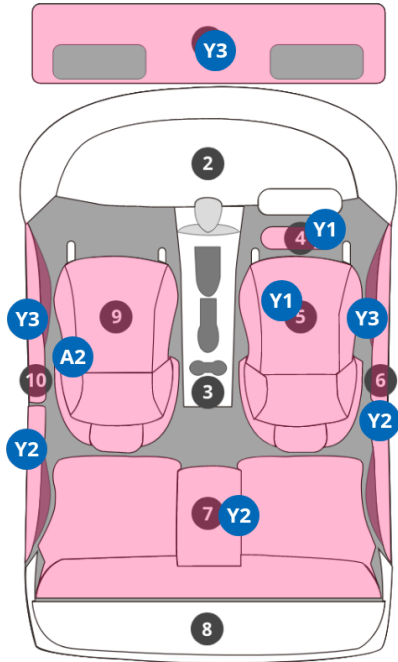
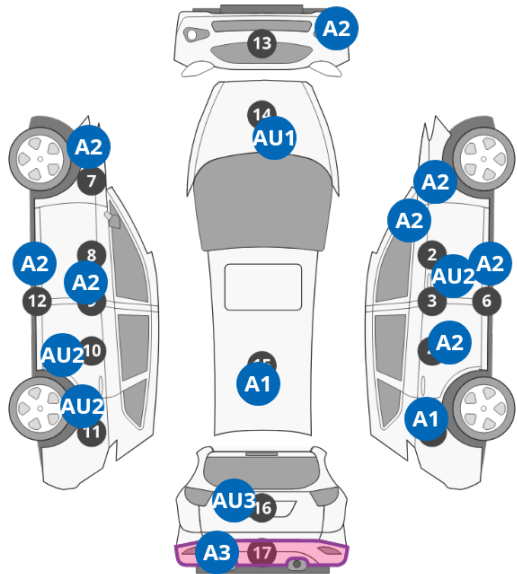
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	107	109	101
2	Boot Lid	94.5	96	97	91
3	Roof	100.1	108	101	95/97
4	Left Front Fender				
5	Left Front Door	106.3	111	102	106
6	Center Panel Left				
7	Left Rear Door	104.0	112	103	97
8	Left Back Panel	100.7	104	99	99
9	Right Front Fender				
10	Right Front Door	104.3	101	104	108
11	Center Panel Right				
12	Right Rear Door	104.3	109	100	104
13	Right Back Panel	104.3	108	101	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Minimal / Ceiling - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Cut, Crack - Small / (R) Front Seat - Grime - Minimal / Overall Interior - Worn as per age - Yes	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Minimal / Overall Exterior - Worn as per age - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

with LTO plate/with warranty booklet/with tools and jack/with spare tire/with spare key/maintenance warning lamp on/key battery low lamp on/reverse light issue/hairline scratches on the body