

## General Information

Date & Time: 22, Jul, 2026 15:49

|                  |        |                   |               |
|------------------|--------|-------------------|---------------|
| Make             | Toyota | Model             | Corolla       |
| YOM              | 2004   | Odo Meter Reading | 219,257       |
| Registration No. | XMT209 | Chassis No.       | ZZE1218010878 |
| CC               | 1.6    | Transmission      | M/T           |
| Fuel Type        | Gas    | Type of Body      | Sedan         |
| Colour           | White  |                   |               |

## Body / Panel Condition



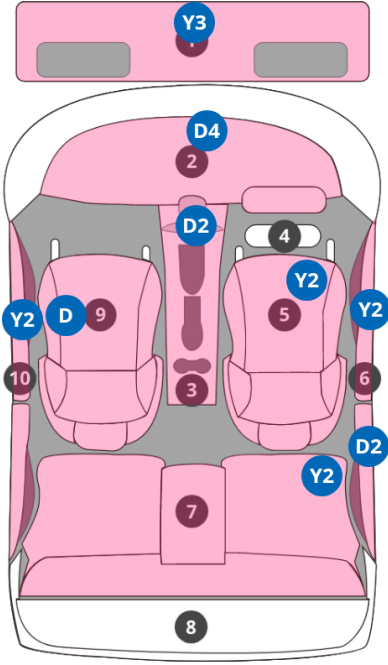
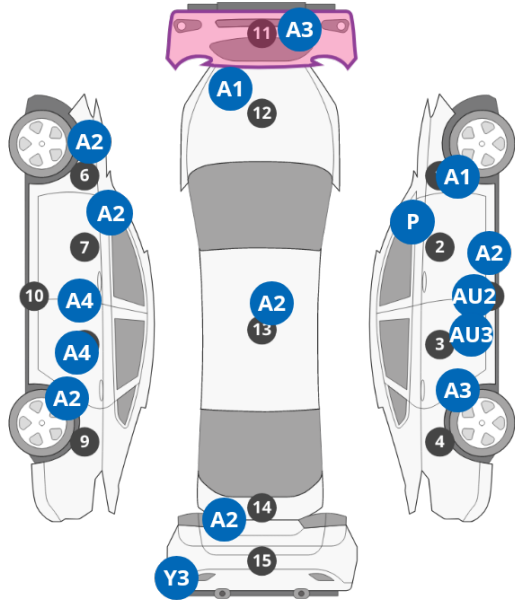
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 104.1         | 102    | 113    | 98       |
| 2  | Boot Lid           | 97.5          | 106    | 99     | 88       |
| 3  | Roof               | 88.5          | 111    | 83     | 78/82    |
| 4  | Left Front Fender  | 187.0         | 192    | 202    | 167      |
| 5  | Left Front Door    | 107.0         | 103    | 111    | 107      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 107.0         | 115    | 105    | 101      |
| 8  | Left Back Panel    | 115.0         | 121    | 120    | 104      |
| 9  | Right Front Fender | 117.0         | 125    | 108    | 118      |
| 10 | Right Front Door   | 109.0         | 113    | 107    | 107      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 115.3         | 108    | 115    | 123      |
| 13 | Right Back Panel   | 114.0         | 106    | 108    | 128      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                                                                                      | Exterior Evaluation : <span style="color: red;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                                            |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>Remarks</b><br>Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / (R) Rear Trim - Worked - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Console, Switchs, Vents - Loose, Deformed - Small / Rear Seat - Grime - Small / Dashboard - Loose, Deformed - Large | <b>Remarks</b><br>(L) Front Fender - Repair Traces - Yes / Overall Exterior - Worn as per age - Yes / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Faded(Color, Gloss) - Yes / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small |
| Frame Evaluation : <span style="color: red;">A</span>                                                                                                                                                                                                                                                                                                                         | Functional Evaluation : <span style="color: red;">C</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                                                                           | <b>Remarks</b><br>Retractable Mirror - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |

| Inspector Notes                                                                                                                                                                                                                               |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack and yellowish headlights and tail light, fog lamp issue, power window button issue, driver's masters switch issue, |